Vision Spectrophotometer

USER MANUAL

Declaration of Conformity

This is to certify that the Vision UV/Visible Spectrophotometers part numbers:

SP-2001, SP-2001PT, SP-2001BL and SP-2001SD manufactured by Hoefer, Inc. conform to the requirements of the following Directives:

73/23/EEC & 89/336/EEC& IVD

Standards to which conformity is declared

EN 61010-1: 2001 Safety requirements for electrical equipment for measurement, control and laboratory use.

EN 61326-2.3: 1998 Electromagnetic compatibility - generic emission standard Electrical equipment for measurement, control and laboratory use.

EN 61000-4-6: 1992 Electromagnetic compatibility - generic immunity standard part 1. Residential, commercial and light industry.

BS EN 591:2001 Instruction for use for in vitro diagnostic instruments for professional use.

BS EN 13612:2002 Performance evaluation of in vitro diagnostic medical devices

2002/96/EC This appliance is marked according to the European directive 2002/96/EC on Waste Electrical and Electronic Equipment (WEEE). By ensuring this product is disposed of correctly, you will help prevent potential negative consequences for the environment and human health, which could otherwise be caused by inappropriate waste handling of this product.

The symbol on the product, or on the documents accompanying the product, indicates that this appliance may not be treated as household waste. Instead it shall be handed over to the applicable collection point for the recycling of electrical and electronic equipment. Disposal must be carried out in accordance with local environmental regulations for waste disposal.

Signed:

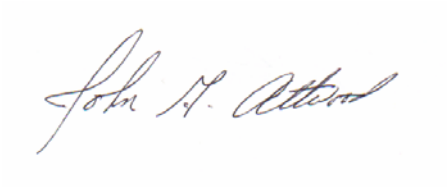

John Attwood
Director of Sales & Marketing
Hoefer, Inc.

Hoefer, Inc.
84 October Hill Road
Holliston, MA 01746

Toll Free: (800) 227-4750
Phone: +1 508-893-8999
Fax: +1 508-429-5732
E mail: support@hoeferinc.com
Website: www.hoeferinc.com

TABLE OF CONTENTS

ESSENTIAL SAFETY NOTES 4
Unpacking, Positioning and Installation 4

INTRODUCTION 5
Your spectrophotometer 5
Sample handling tips 5
Keypad and display 6
Software style 8

THE APPLICATIONS FOLDER 9
1: Single Wavelength – Abs and %T 10
2: Concentration 12
3: Wavescan 14
4: Simple Kinetics 17
5: Standard Curve 20
6: Multiple Wavelength 24
7: Absorbance Ratio 25

THE LIFE SCIENCE FOLDER 27
1: DNA 29
2: RNA 31
3: Oligo 33
Protein Determination 35
1: Protein UV 36
2: BCA 38
3: Bradford 41
4: Lowry 44
5: Biuret 47
Bacterial Cell Culture Measurement (OD600) 50

FAVORITES AND METHODS FOLDERS 52

UTILITIES FOLDER 53
Utilities 54
1: Date and Time 54
2: Regional 54
3: Printer 54
4: Preferences 55
5: Contrast 55
6: Folder Names 55
7: About 56
8: Games 56

ACCESSORIES INSTALLATION 58
Printer installation 58
Loading / changing the printer paper 60
Bluetooth accessory installation 61

PRINT VIA COMPUTER 64

ACCESSORIES 65
Lamp Replacement 65
Cleaning and general care of the instrument 65

SPECIFICATION AND WARRANTY 66

ESSENTIAL SAFETY NOTES

There are a number of warning labels and symbols on your instrument. These are there to inform you where potential danger exists or particular caution is required. Before commencing installation, please take time to familiarise yourself with these symbols and their meaning.

Caution (refer to accompanying documents).
Background color yellow, symbol and outline black.

Unpacking, Positioning and Installation

- Check the contents of the pack against the packing list. If any shortages are discovered, inform your supplier immediately.
- Inspect the instrument for any signs of damage caused in transit. If any damage is discovered, inform your supplier immediately.
- Ensure your proposed installation site conforms to the environmental conditions for safe operation:
  Indoor use only.
  Temperature range 5°C to 35°C. Note that if you use the instrument in a room subjected to extremes of temperature change during the day, it may be necessary to recalibrate (by switching off and then on again) once thermal equilibrium has been established (2-3 hours).
  Maximum relative humidity of 80% up to 31°C decreasing linearly to 50% at 40°C
- The instrument must be placed on a stable, level bench or table that can take its weight (< 4.5 kg) so that air can circulate freely around the instrument.
- This equipment must be connected to the power supply with the power cord supplied. It can be used on 90 – 240 V, 50-60 Hz supplies.
- If the instrument has just been unpacked or has been stored in a cold environment, it should be allowed to come to thermal equilibrium for 2-3 hours in the laboratory before switching. This will prevent calibration failure as a result of internal condensation.
- Switch on the instrument via the keypad ( ) after it has been plugged in. The instrument will perform a series of self-diagnostic checks.
- Please read through this user manual prior to use.
- Please contact your original supplier in the first instance if you experience technical or sample handling difficulties.

If this equipment is used in a manner not specified or in environmental conditions not appropriate for safe operation, the protection provided by the equipment may be impaired and instrument warranty withdrawn.

INTRODUCTION

Your spectrophotometer

Your spectrophotometer is a simple-to-use UV/Visible instrument with a CCD array detector (1024 pixels). It has no moving parts, which is the basis of the rapid scanning operating system.

The user interface is built around folders which are displayed on the home page when the instrument is switched on. After switch on and calibration, the default home page is "Vision" offering the choice of

Applications	General spectroscopic methods
Favorites	A folder to store your more frequently used configured methods
Methods	Contains nine folders that can store less frequently used configured methods (nine methods per folder)
Utilities	Instrument set up (date, time, language, etc) and games
Life Science	Standard Life Science methods such as nucleic acid assays, protein assays and cell counting

The instrument is supplied with a program PVC (Print via Computer) on the accompanying CD. When used with a USB cable to connect to a PC onto which the software has been installed, it enables the user to “print through” the PC directly to the printer that is connected to it. The data may also be stored as an Excel spreadsheet, as an EMF graphics file, a comma delimited (csv) data file, a tab delimited (txt) data file or in native PVC format for later access

Alternatively, results may be sent to the PC via a Bluetooth accessory; this can either be supplied pre-installed or is available as an optional accessory if the need for its use arises after installation of the product. PVC works in a similar way.

A printer is available for the instrument; this may either be supplied pre-installed or is available as an optional accessory if the need for its use arises after installation of the product.

Sample handling tips

- Note that the light beam is directed from RIGHT to LEFT through the cell chamber; therefore please ensure the cell is inserted in the correct alignment.
- The cell holder supplied with the instrument accepts standard 10 mm pathlength quartz, glass or plastic cells.
- The optical beam height is 15 mm, and the minimum volume that can be used is approximately 10µl in a Quartz ultra-micro cell.
- 12 mm test tubes may be used (e.g. for cell cultures), however they are not recommended as higher quality data is produced by using disposable cuvettes for the analysis. If used, align the indicator line on 12 mm test tubes in the same direction to ensure reproducible positioning of the tube. Note that test tubes do not last forever, and that the surface becomes scratched and blemished through repetitive use; if this is the case they should be replaced.

Keypad and display

The back-lit liquid crystal display is very easy to navigate around using the alphanumeric entry and navigation arrow keys on the hard wearing, spill proof membrane keypad.

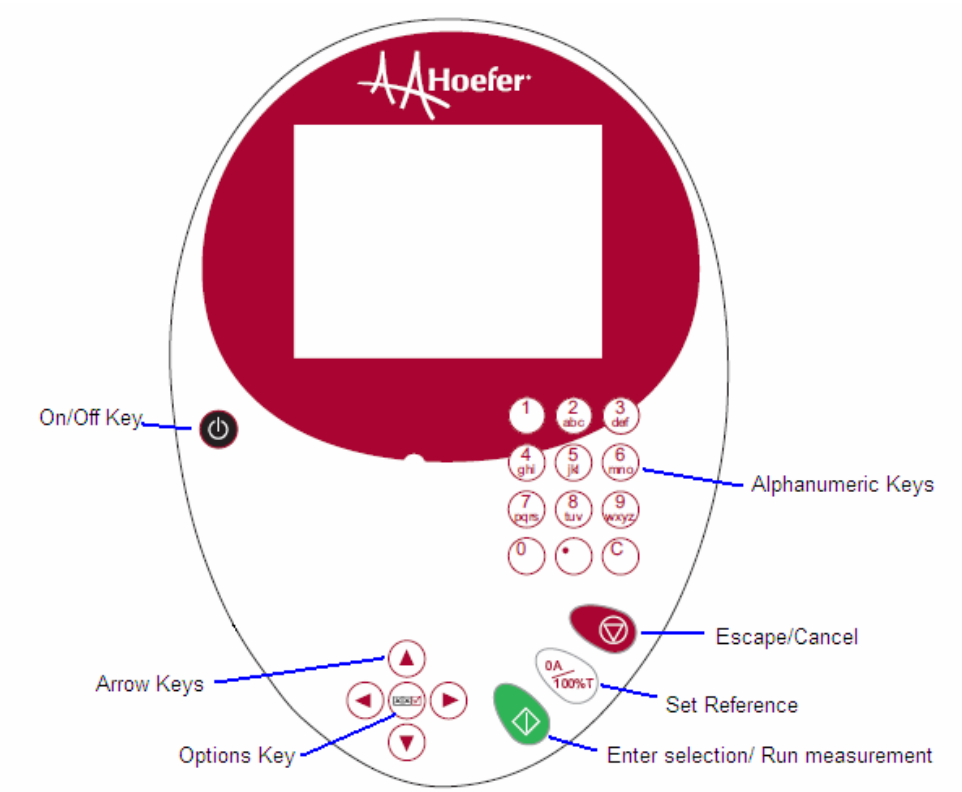

Key	**Action**
On/off key	Turns the instrument on/off
Arrow keys	Use the four arrow keys to navigate around the display and select the required setting from the active (highlighted) option.
View Options: ☒☒☑	View options for that application mode. Some of these are common to all applications and described below. Options unique to an application are described in the relevant section.
Alphanumeric keys	Use these to enter parameters and to write text descriptions where appropriate, or required. Use repeated key presses to cycle through lower case, number and upper case. Leave for 1 second before entering next character. Use C button to backspace and 1 to enter a space.
Escape/Cancel: ▽	Escape from a selection and return to the previous folder. Stop making measurements.
Set Reference: 0A/100%T	Set reference to 0.000 A or 100%T on a reference solution at the current wavelength in the mode selected. When in scan mode, do a reference scan.
Enter: ◇	Enter, or confirm, a selection. Take a measurement.

Options (select using key pad numbers)

1.	View parameters for the experiments.
2.	Print the results.
3,4,5,6	Described in the application.
7.	Define the sample number you wish to start from.
8.	Save the parameters as a method to a defined folder name with a defined method name.
9.	Toggle auto-print on/off. Default is off.

Exit options by pressing, or wait.

Experienced operators can use the numeric keys as a shortcut to the option required without needing to enter the Options menu.

Software style

The user interface is built around having folders of files which are displayed on the home page when the instrument is switched on. Different folders are numbered and opened by using the associated number key on the keypad.

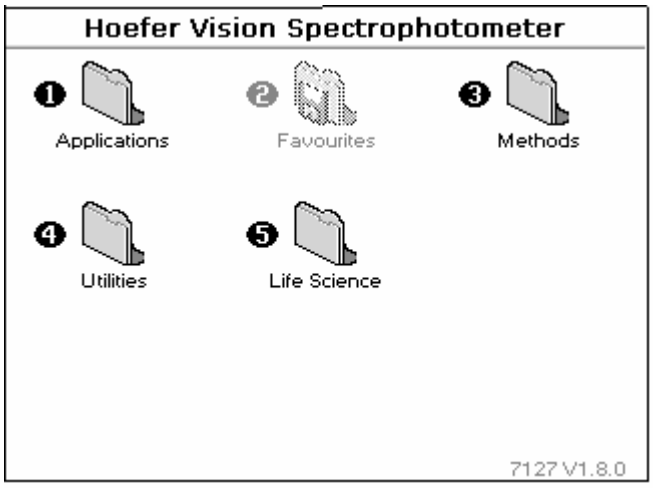

Summary Function	Keypad number	Description
	1	Single wavelength, Concentration, Wavelength scan, Kinetics, Standard Curve, Multiple wavelengths and Ratio
	2	Saved User selected and configured methods
	3	Sub folder selection for user selected and configured methods
	4	Instrument set up (date, time, language, etc) and Games
	5	Nucleic acids, Proteins and Cell counting

THE APPLICATIONS FOLDER

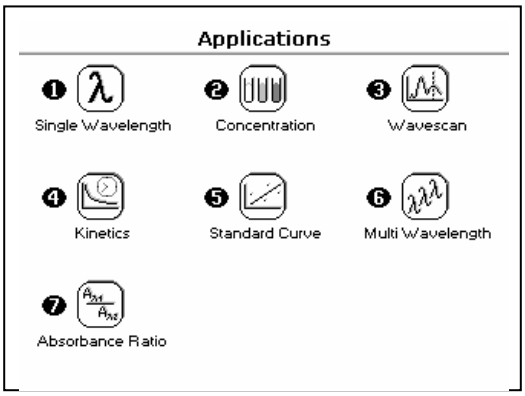

SUMMARY:

Function	Key pad number	Description
Single Wavelength	1	Absorbance or %T (Transmission) at a single user defined wavelength.
Concentration	2	Concentration measurement at a single wavelength based on a simple Factor entered or calculated from a single standard.
Wavescan	3	Wavelength scan between two user defined wavelengths. Range 200-950 nm, with user configurable peak finding function.
Kinetics	4	Absorbance versus time measurements either rate or end value based.
Standard Curve	5	Generation of calibration curve by measuring standards at a single wavelength.
Multi Wavelength	6	Absorbance or %T (Transmission) at up to 5 user defined wavelengths.
Absorbance Ratio	7	Ratio of absorbance values at two user specified wavelengths.

OPTIONS

Within each application the user has the possibility to select various options that define the way results are treated. If not using a stored method, it is advisable to check that these Options have been appropriately set for your experiment when coming to the instrument. Note that setting the “History” parameter to on (see Preferences later) will cause the instrument to store it’s last settings. If the “History” parameter is turned off, all parameters and options will return to their default settings when you leave that application. (Unless it has been saved as a method).

1: Single Wavelength – Abs and %T

This makes simple Absorbance (A) and % Transmission (%T) measurements on samples, measuring the amount of light that has passed through a sample relative to a reference (this can be air).
The procedure is as follows:

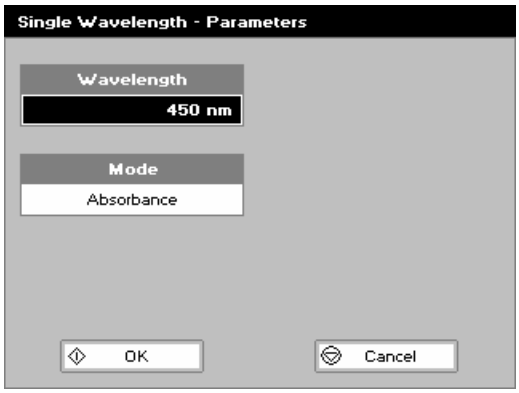

Step 1
Set wavelength by using keypad numbers or left and right arrows.
Press the down arrow key.
Step 2
Select the mode, *Absorbance* or *%T*, using the left and right arrows.
Step 3
To enter the results screen with the selected parameters press OK
OR
Cancel the selections and return to the Applications Folder by pressing Cancel.

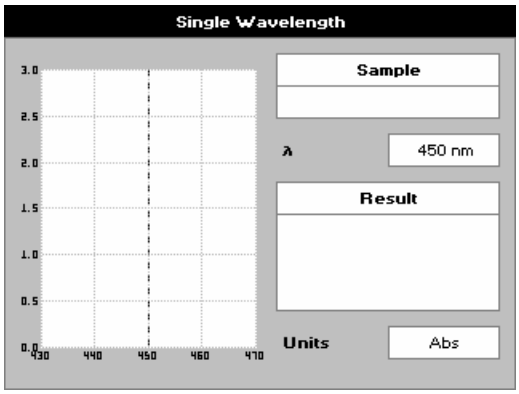

Step 4
Insert the reference. Press 0A/100% key. This will be used for all subsequent samples until changed.
Step 5
Insert sample and press .

Repeat step 5 for all samples.

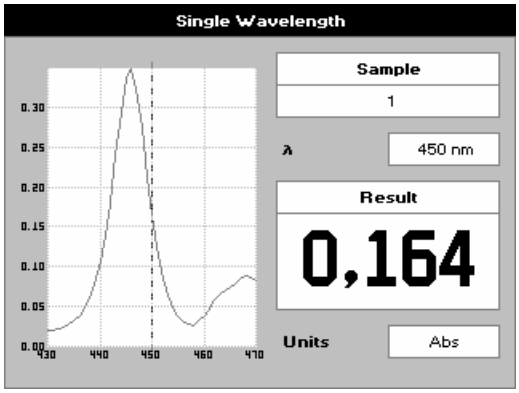

Results
The result at the selected wavelength is displayed on screen. Use the left and right arrows to move the cursor and display the value at the cursor position (+/- 15nm from set wavelength).

Press Cancel to return to the Applications Folder.

Press ☒☒☑ to display available Options which are described below.

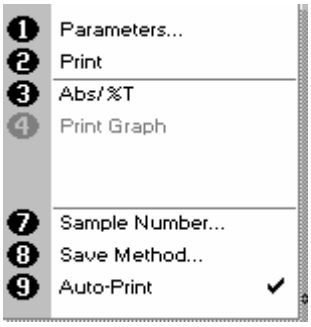

Options (select using key pad numbers)

1. Return to parameters screen (step 1 above).
2. Print result via selected method.
3. Toggle between Absorbance and %T mode.
4. Print graph – grayed out if no data are available.
7. Sample number – add a prefix to the sample number and reset the incrementing number to the desired value.
8. Save method – use the left and right arrows to select a folder to store in (Favorites/Methods 1-9), press the down arrow and enter name.
9. Auto-print – toggles auto-print on/off.

Exit options by pressing ▽, or wait.

2: Concentration

This makes simple concentration measurements on samples, by measuring the amount of light that has passed through a sample relative to a reference (this can be air). Concentration is obtained by multiplying the measured Absorbance at a specific wavelength by a factor. The factor may be known in advance, or may be calculated by the instrument by measuring a standard of known concentration.

The procedure is as follows:

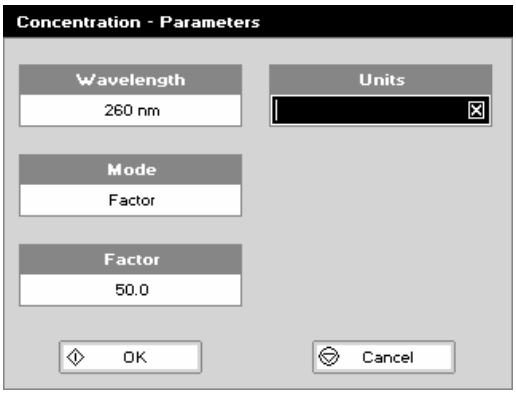

Step 1
Set wavelength by using keypad numbers or left and right arrows.
Press the down arrow key.
Step 2
Select the mode, Factor (user entered) or Standard (factor is calculated from a calibration sample), using the left and right arrows.
Press the down arrow key.
Step 3 (if Factor is selected)
Enter the Factor using the keypad numbers. Range 0.001 to 9999. Use the C button to delete the last digit entered.
Press the down arrow key.
Step 3 (if Standard is selected)
Enter the concentration using keypad numbers. Range 0.01-9999. Use the C button to delete the last digit entered.
Press the down arrow key.

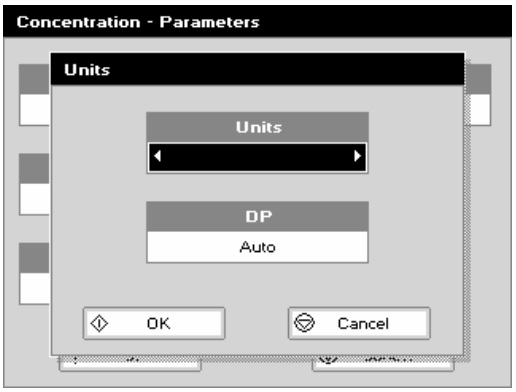

Step 4
Units: The user can enter a text string up to 8 characters long. To access a list of pre-defined units press the Options key ☒☒☑ and then use the left/right arrows (µg/ml, µg/µl, pmol/µl, mg/dl, mmol/l, µmol/l, g/l, mg/l, µg/l, U/l, %, ppm, ppb, conc or none). These units can also be edited once OK is pressed.
This screen also allows the number of displayed decimal points (DP) to be selected, from 0 to 2 Note that the result will always be fixed to 5 significant figures regardless of how many decimal points are selected (so 98768.2 will display as 98768 even with 1 decimal point selected). Press OK ◈ to store the chosen parameters or Cancel ▽.

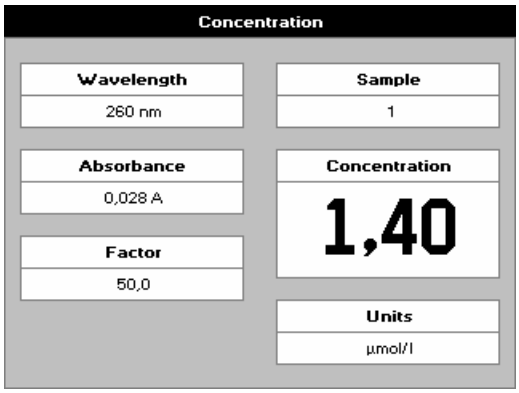

Step 5
To enter the results screen with the selected parameters press OK ◈
OR
Cancel the selections and return to the Applications Folder by pressing Cancel ▽.
Step 6 (if using a Factor)
Insert the reference. Press 0A/100% key. This will be used for all subsequent samples until changed.
Step 7
Insert sample and press ◈.

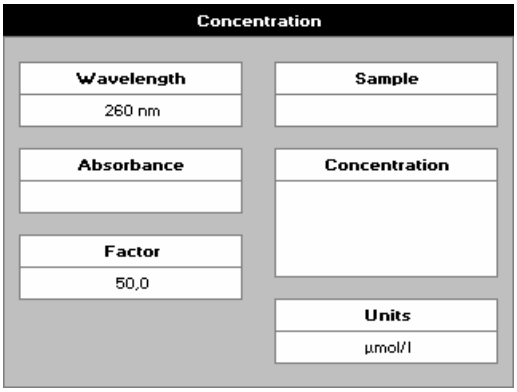

Step 6 (if using standard mode)
Insert the reference. Press 0A/100% key. This will be used for all subsequent samples until changed.
Press ◈ to display the Run Standard screen.
Run the standard by pressing ◈
OR
Press cancel ▽ to return to the measure screen.

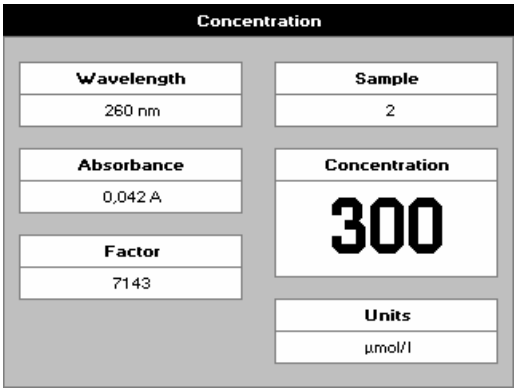

Step 7
Insert the sample and press ◈.
The concentration of the sample is displayed. Results shown as ---- indicate the concentration is out of range.

Repeat step 7 for all samples.

Press ▽ to return to the Applications Folder.

Press ☒☒☑ to display available Options which are described below.

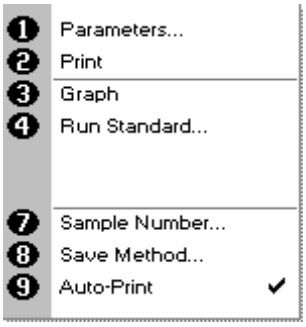

Options (select using key pad numbers)
1. Return to parameters screen (step 1 above).
2. Print result via selected method.
3. Toggles on/off, displaying a graph of wavescan +/- 20 nm from selected wavelength.
4. Return to Run Standard screen.
7. Sample number – add a prefix to the sample number and reset the incrementing number to the desired value.
8. Save method – use the left and right arrows to select a folder to store in (Favorites/Methods 1-9), press the down arrow and enter name.
9. Auto-print – toggles auto-print on/off.

Exit options by pressing ▽, or wait.

3: Wavescan

An absorption spectrum can be obtained from your instrument, enabling simple identification of peak height and position. The procedure is as follows:

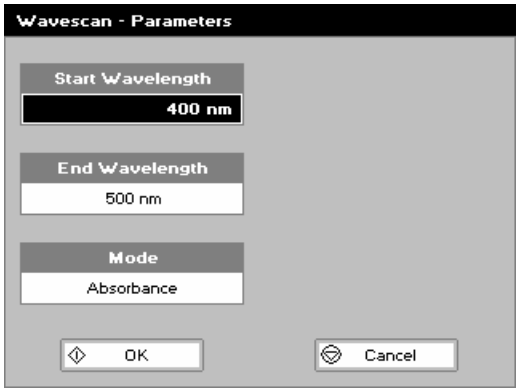

Step 1
Set start wavelength by using keypad numbers or left and right arrows.
Press the down arrow key.
Step 2
Set end wavelength by using keypad numbers or left and right arrows.
Press the down arrow key.
Step 3
Select the mode, *Absorbance* or *%T*, using the left and right arrows.
Step 4
To enter the measurements screen with the selected parameters press OK ◈
OR
Cancel the selections and return to the Applications Folder by pressing Cancel ▽.

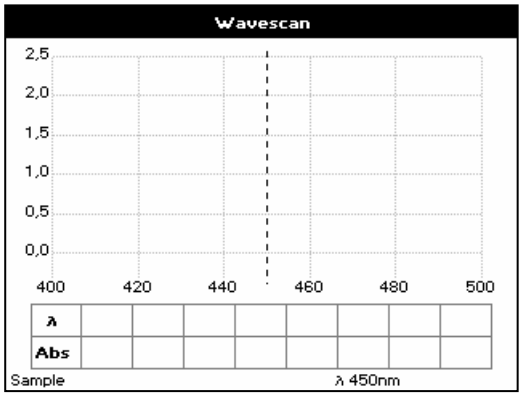

Step 5
Insert the reference. Press 0A/100% key. This will be used for all subsequent samples until changed.
Step 6
Insert sample and press ◈.

Repeat step 6 for all samples.

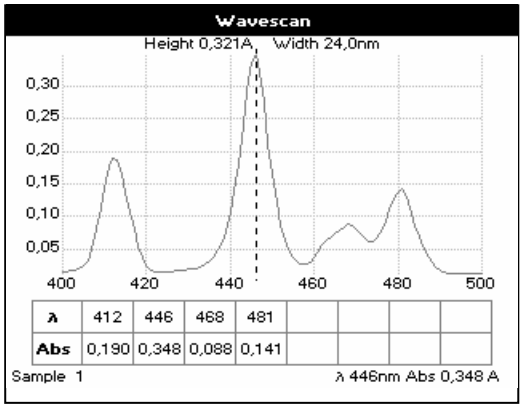

Results
A graph of the wavescan is displayed, along with a table of Absorbance/%T at each peak. Use the left and right arrows to move the cursor along the graph. When it reaches a peak the peak height and width of the peak is displayed at the top of the screen.
To zoom in on the wavelength scale, use the up arrow. This auto-scales on the Absorbance/%T scale (dependent on the Graph Scale option) and this is retained for subsequent measurements.
To zoom out again, use the down arrow.

Press ▽ to return to the Applications Folder.

Press ☒☒☑ to display available Options which are described next.

Options (select using key pad numbers)

1. Return to parameters screen (step 1 above).
2. Print result via selected method.
3. Toggle between Absorbance and %T mode.
4. Displays Peak Detection Parameter Screen. See description below.
5. Manually adds a peak position to the peak table in the results screen at the position set by the cursor. If the cursor is returned to this position the legend “User Defined Peak” is displayed at the top of the scan and this option changes to Delete Peak...
6. Displays Graph Scale Parameter Screen. See description below.
7. Sample number – add a prefix to the sample number and reset the incrementing number to the desired value.
8. Save method – use the left and right arrows to select a folder to store in (Favorites/Methods 1-9), press the down arrow and enter name.
9. Auto-print – toggles auto-print on/off.

Exit options by pressing ▽, or wait.

Peak Detection (Shortcut button 4)

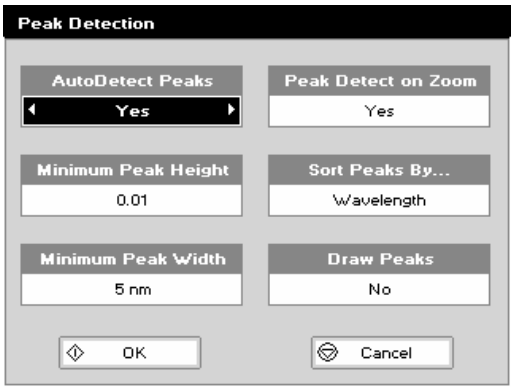

AutoDetect Peaks: Turns on and off the automatic peak detection. The following options determine how peaks are detected:
Minimum peak height: Minimum height the peak has to be above the higher of the two adjacent minima for the peak to be detected
Minimum peak width: Minimum width of the peak as determined by the difference in wavelength between the higher of the two adjacent minima and the opposing intersection of that higher minimum level and the peak profile. (See the screen displayed below).

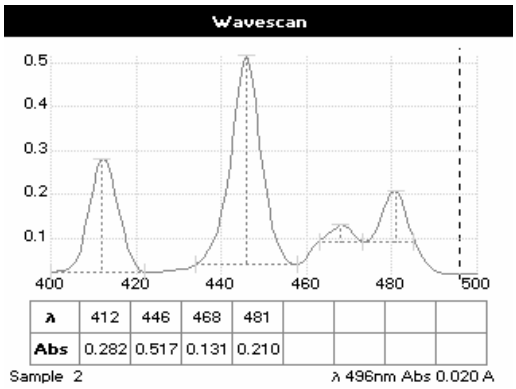

Peak Detect on Zoom: Determines whether peaks are re-assessed and tabulated when the user zooms into a region of the wavescan. If off leaves the peak detection as determined on the un-zoomed display

Sort peaks by…: Determines the sequence that peaks are reported by. Can be wavelength, peak height or peak width.

Draw Peaks: Switches display of peak cursors on and off. These show vertical dashed lines displaying the measured peak height and horizontal dashed lines showing the peak width

Pressing Cancel ▽ ignores the selection, pressing ◇ accepts them.

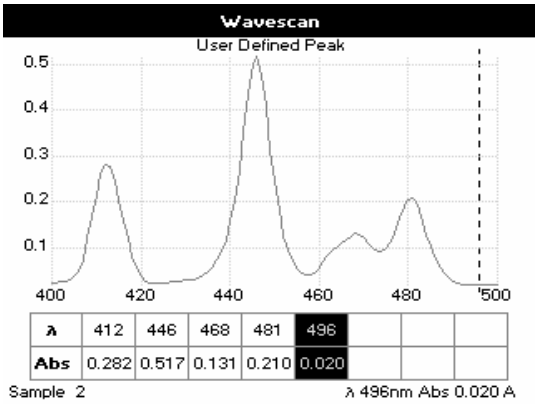

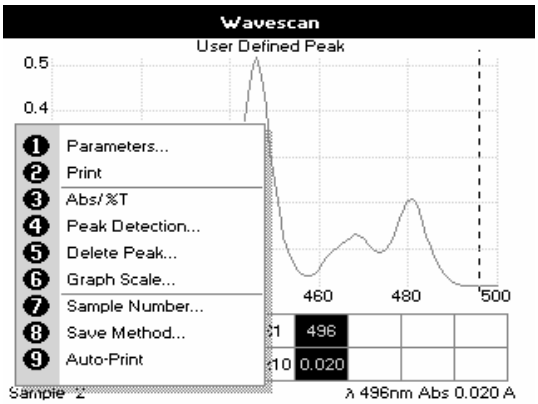

Add Peak... (Shortcut button 5)

Adds a used defined peak at the current cursor position. The entry is then displayed in inverse coloring to discriminate between user defined peaks and auto-detect peaks. When the cursor is positioned over the user defined peak a legend “User Defined Peak” appears at the top of the graph. The option then changes to Delete Peak to enable the user to remove the peak.

Note: Storing a method at this stage will save these user defined wavelengths, each time method is run Absorbance value at these wavelengths is reported

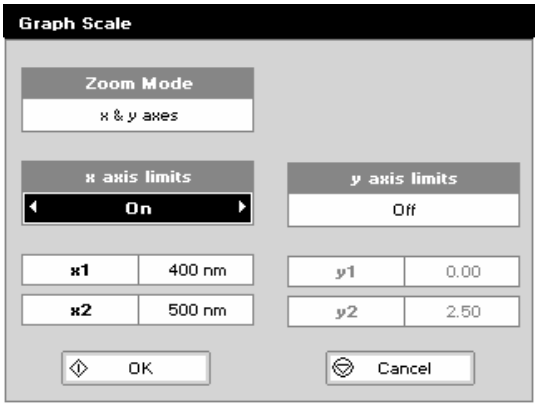

Graph Scale…
This enables the user to set up a defined graph by defining the limits in either or both of the x and y axes.

Zoom mode:
This sets up the operation of the Zoom keys (up and down arrows). “x & y axes” expands the display around the cursor measurement point, whilst the other options select the absorbance or wavelength axes respectively. With x or y axis limits set to on, zooming out will only be permitted to the set limits.

x/y axis limits:
Setting “x (or y) axis limits” to “On” activates the start and finish points of the desired graph to user defined specific wavelengths and/or absorbance values.

Pressing Cancel ▽ ignores the selection; pressing ◇ accepts them and displays the required graph.

4: Simple Kinetics

Kinetics studies, where the change in absorbance needs to be followed as a function of time at a fixed wavelength, can be readily performed.

Reagent test kits are routinely used for the enzymatic determination of compounds in food, beverage and clinical laboratories by measuring NAD / NADH conversion at 340 nm. The change in absorbance over a specified time period can be used to provide useful information when an appropriate factor, defined in the reagent kit protocol, is applied. Reaction rate and enzyme activity can be calculated if the factor used takes account of the absorbance difference per unit time, as opposed to the absorbance difference *per se*.

For this reason, the change in absorbance per minute **(ΔA/min**), concentration (**ΔA/min x factor**) and **correlation coefficient** (calculated from a best fit of the data points) are displayed. They may not be relevant for simple kinetics experiments.

The procedure to define a new method is as follows:

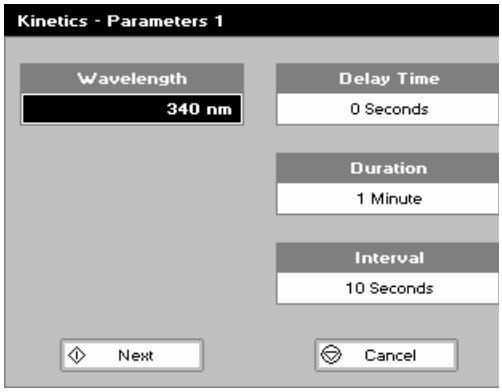

Kinetics Parameters 1 Screen
Step 1 (Wavelength)
Enter all numerical values using the keypad numbers or the left and right arrows. Use the up and down arrow keys to move between boxes.
Step 2 (Delay time)
Enter the delay time in seconds before measurements are taken. This can be a maximum of 600 seconds (10 minutes).
Step 3 (Duration)
Enter the time in minutes over which measurements are taken. This can be a maximum of 60 minutes.
Step 4 (Interval)
Enter the interval time in seconds between measurements using the left and right arrows. Options are: 5, 10, 20, 30 or 60 seconds.
Step 5
Press Next to go to the next parameters screen
OR
Press Cancel to return to the Applications Folder.

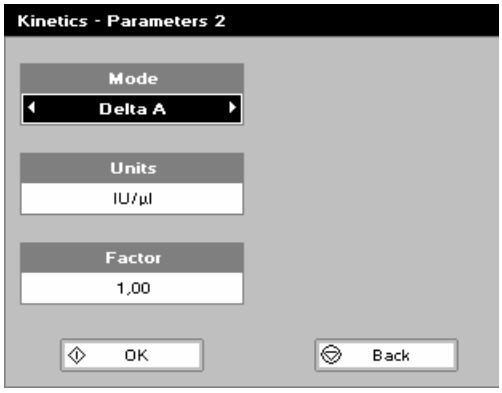

Kinetics Parameters 2 Screen
Step 6
Select the measurement mode using the left and right arrows.
Delta A: change in absorbance over the measurement duration (or selected period).
Final A: absorbance at the end of the measurement duration (or selected time).
Slope: rate of change of absorbance over the measurement duration or selected period.

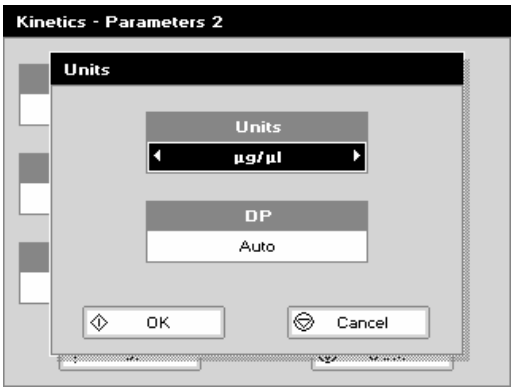

Step 7
Units: The user can enter a text string up to 8 characters long. To access a list of pre-defined units press the Options key ☒☒☑ and then use the left/right arrows (µg/ml, µg/µl, pmol/µl, mg/dl, mmol/l, µmol/l, g/l, mg/l, µg/l, U/l, %, ppm, ppb, conc or none). These units can also be edited once OK is pressed.
This screen also allows the number of displayed decimal points (DP) to be selected, from 0 to 2 Note that the result will always be fixed to 5 significant figures regardless of how many decimal points are selected (so 98768.2 will display as 98768 even with 1 decimal point selected). Press OK ◈ to store the chosen parameters or Cancel ▽.

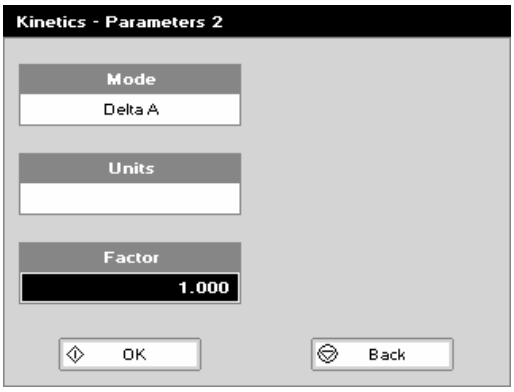

Step 8
Set the Factor by which the result is multiplied to give the amount in the chosen range using the left and right arrows. Range of 0.01 to 9999.

Step 9
Press Next ◈ to enter the Results screen
OR
Press Cancel ▽ to return to the Parameters 1 screen.

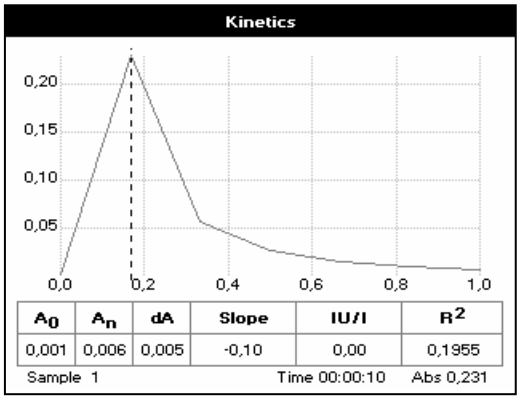

Results
Insert the reference and press the 0A/100%T key.

Insert the sample and press ◈ to start the run.

Time (min) is displayed at the bottom of the screen, and absorbance data are plotted on the graph as testing proceeds. The table below the graph gives: Absorbance values at T_0 (start of calculation), T_n (finish of calculation, change in absorbance, slope, regression parameter (R^2) of the calculated slope and the result calculated from the selected parameter (dA, final A or slope).

Use the left and right arrows to move the cursor and display the time and absorbance value at measured data points.

Use the up and down arrows to zoom in or out.

Press Cancel ▽ to return to the Applications Folder.

Press ☒☒☑ to display available Options which are described below.

Options (select using key pad numbers)

1. Return to parameter 1 screen (step 1 above).
2. Print data on the results screen via selected method.
3. Print all the data.
4. Set the t_0 position (starting point for the slope and dA calculation) at the current cursor position. Value is retained for subsequent samples.
5. Set the t_n position (finishing point for the slope and dA calculation) at the current cursor position. Value is retained for subsequent samples.
6. Toggle the calculated slope line on and off.
   Note: if any data points enclosed by t_0 and t_n are beyond the range of the instrument (>2.5A or <-0.3A) then this option is grayed out.
7. Sample number – add a prefix to the sample number and reset the incrementing number to the desired value.
8. Save method – use the left and right arrows to select a folder to store in (Favorites/Methods 1-9), press the down arrow and enter name.
9. Auto-print – toggles auto-print on/off.

Exit options by pressing ⓥ, or wait.

5: Standard Curve

The construction of a multi-point calibration curve from standards of known concentration to quantify unknown samples is a fundamental use of a spectrophotometer; this instrument has the advantage of being able to store this curve as a method, using up to 9 standards.

To include a zero concentration standard, include this in the number of standards to be entered and enter 0.00 for concentration; use a reagent blank when required to enter the zero standard.

The procedure is as follows:

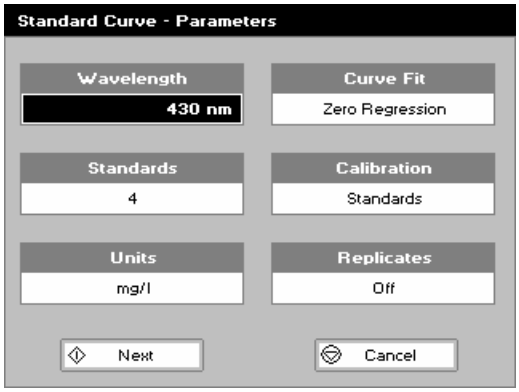

Step 1
Select the wavelength using the keypad numbers or left and right arrows.
Press the down arrow.
Step 2
Enter the number of standard concentration points to be used in the curve (1-9).
Press the down arrow.

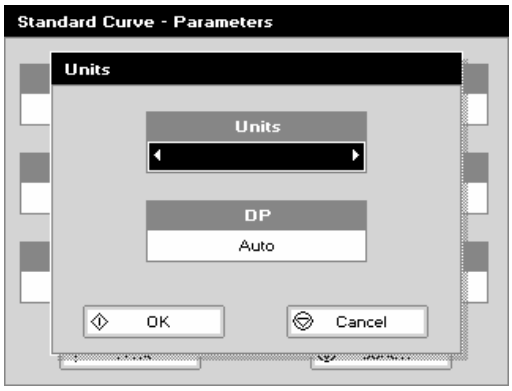

Step 3
Units: The user can enter a text string up to 8 characters long. To access a list of pre-defined units press the Options key ☒☒☑ and then use the left/right arrows (µg/ml, µg/µl, pmol/µl, mg/dl, mmol/l, µmol/l, g/l, mg/l, µg/l, U/l, %, ppm, ppb, conc or none). These units can also be edited once OK is pressed.
This screen also allows the number of displayed decimal points (DP) to be selected, from 0 to 2 Note that the result will always be fixed to 5 significant figures regardless of how many decimal points are selected (so 98768.2 will display as 98768 even with 1 decimal point selected). Press OK ◈ to store the chosen parameters or Cancel ▽.

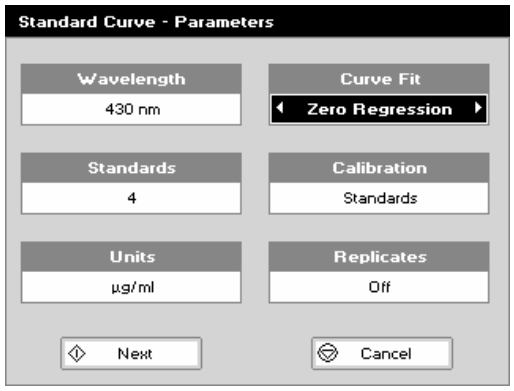

Step 4
Select the type of curve fit using the left and right arrows.
Options: straight line regression, a zero regression (this forces the straight line through the origin), interpolated or cubic spline.
Step 5
Select the calibration mode: either Standards (measure prepared standards) or Manual (keypad data entry).
Press the down arrow.
Step 6 (if standards has been selected in step 5)
Select the number of standards to be measured and averaged at each standard concentration point. Can be OFF (1), 2 or 3.
Step 7
Press Next ◈ to enter the Standards screen
OR
Press Cancel ▽ to cancel selections and return to the Applications Folder.

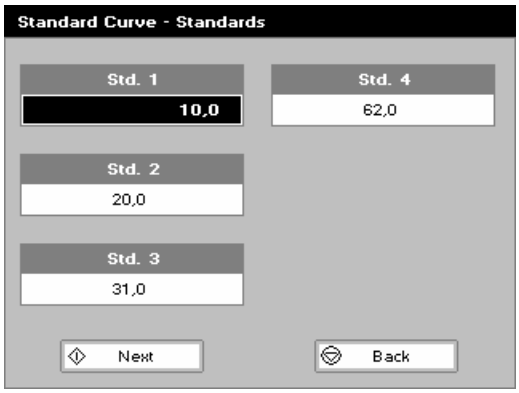

Standards screen
Step 8
Enter the concentration values by using the keypad numbers and the up and down arrows to move between the different standard boxes. Range 0.001 to 9999.
Step 9
Press Next ◈ to enter the Calibration screen. If any duplicate or non-monotonic (increasing entries) are present the unit will beep and highlight the incorrect entry
OR
Press Back ▽ to return to the Parameter screen.

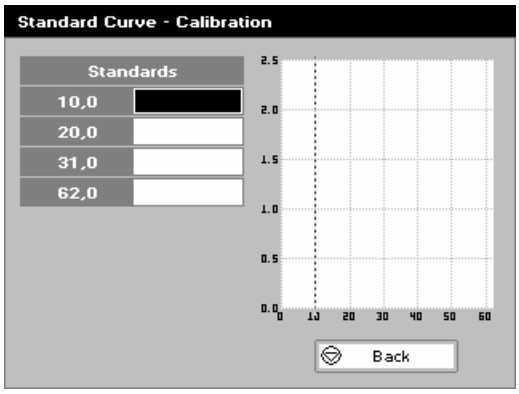

Calibration Screen (replicates off)
This shows the calibration values and allows standards to be measured.
Step 10
Insert the reference. Press 0A/100% key.
This will be used for all subsequent samples until changed.
Step 11
Insert the standard (use C to clear previously stored results before measuring).
Press ◈ to measure the standard and store the result.

Repeat for all standards.

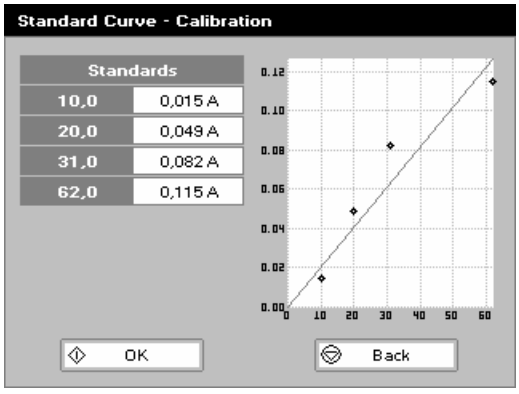

A graph will display the results and the fitted curve as the measurements are input.

Use the up and down arrows to select a standard to be repeated if a poor reading has been obtained. Use C to clear the previous reading.

Step 12
Press OK ◈ to accept the calibration and go to the Results screen (see below)
OR
Press Back ▽ to return to the Standards screen.

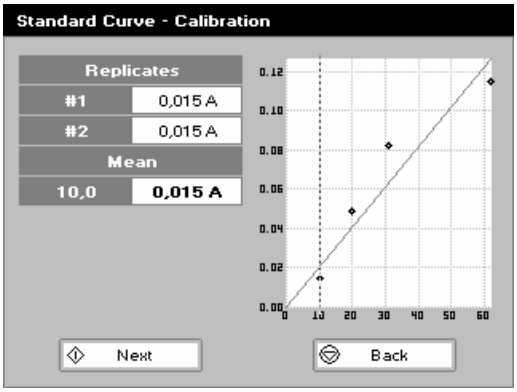

Calibration Screen (replicates on)
This shows the calibration values and allows standards to be measured.
Step 10
Insert the reference. Press 0A/100% key.
This will be used for all subsequent samples until changed.
Step 11
Press ◈ to display the replicate entry boxes. Use C to clear previously stored results before measuring.
Insert the standard and press Enter to measure the standard and store the result.
Repeat for all replicates and standards.

A graph will display the results and the fitted curve as the measurements are input.
Use the up and down arrows to select a standard to be repeated if a poor reading has been obtained. Use C to clear the previous reading.
Step 12
Press ◈ to accept the calibration and go to the Results screen (see below)
OR
Press Back ▽ to return to the Standards screen.

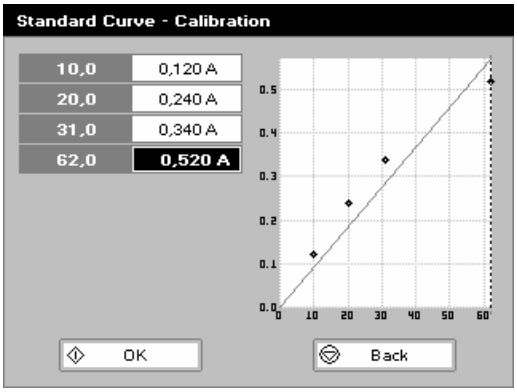

Calibration (Manual entry)
Shows previously entered calibration values and allows values to be entered via the keypad.
The highlighted box can be edited in order to enter an absorbance value corresponding to a given concentration value using the keypad numbers. Range 0.001 to 9999. Use C to backspace and clear the last digit entered and the up and down arrows to move between boxes.
Press OK ◈ to accept the calibration and go to the Results screen (see below)
OR
Press Back ▽ to return to the Standards screen.

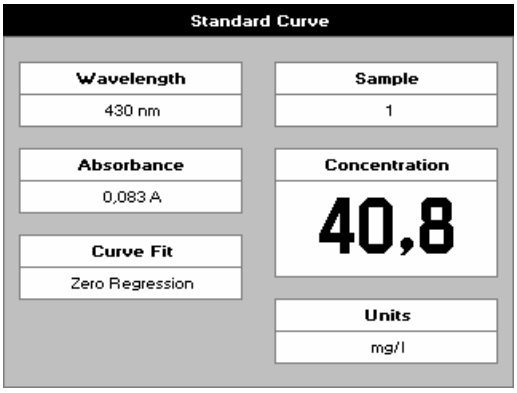

Results screen
Step 13
Insert the reference and press the 0A/100%T key. This will be used for all subsequent samples until changed.
Step 14
Insert the sample and press ◈.
The concentration of the sample is taken and displayed.
Repeat step 14 for all samples.
Press ▽ to return to the Applications Folder.

Press ☒☒☑ to display available Options which are described below.

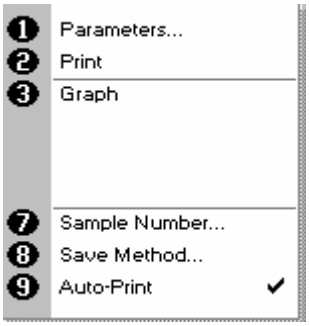

Options (select using key pad numbers)

1. Return to parameters screen (step 1 above).
2. Print result via selected method.
3. Toggle graph on/off. Displays calibration graph, cursors give values for last measured sample.
7. Sample number – add a prefix to the sample number and reset the incrementing number to the desired value.
8. Save method – use the left and right arrows to select a folder to store in (Favorites/Methods 1-9), press the down arrow and enter name.
9. Auto-print – toggles auto-print on/off.

Exit options by pressing ⓥ, or wait.

6: Multiple Wavelength

This makes up to 5 absorbance measurements on the same sample. The procedure is as follows:

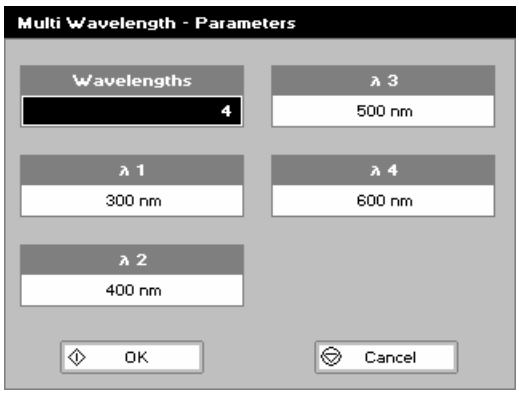

Step 1
Select the number of wavelengths.
Press the down arrow.
Step 2
Enter the first wavelength using either the number keys or the left and right arrows.
Press the down arrow.
Enter the second wavelength as above and repeat for the number of wavelengths selected (up to 5).
Step 3
Press OK ◈ to enter the results screen
OR
Press Cancel ▽ to return to the Applications Folder.

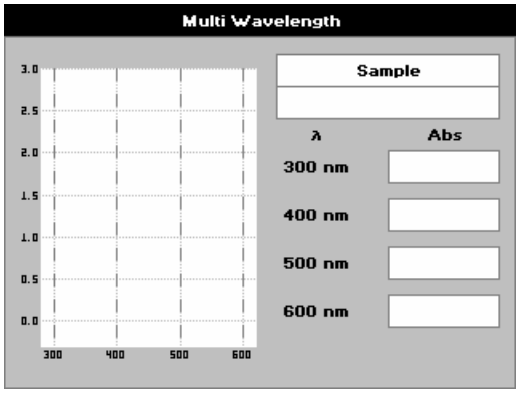

Step 4
Insert the reference. Press 0A/100% key. This will be used for all subsequent samples until changed.
Step 5
Insert sample and press ◈.

Repeat step 5 for all samples.

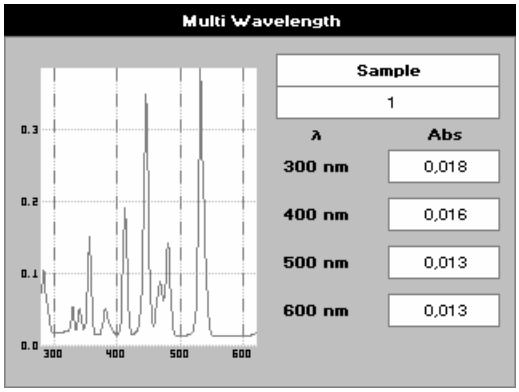

Results
A scan plot covering the range of wavelengths selected (with cursors at the relevant wavelengths) and a table of values is displayed.

Press ▽ to return to the Applications Folder.

Press ☒☒☑ to display available Options which are described below.

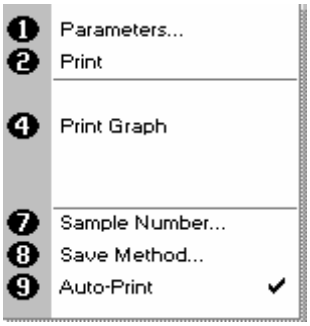

Options (select using key pad numbers)
1. Return to parameters screen (step 1 above).
2. Print result via selected method.
4. Print graph using selected method. Grayed out if no data are available.
7. Sample number – add a prefix to the sample number and reset the incrementing number to the desired value.
8. Save method – use the left and right arrows to select a folder to store in (Favorites/Methods 1-9), press the down arrow and enter name.
9. Auto-print – toggles auto-print on/off.

Exit options by pressing ▽, or wait.

7: Absorbance Ratio

This makes simple Absorbance ratio measurements on samples, measuring the amount of light that has passed through a sample relative to a blank (this can be air) at two wavelengths. The procedure is as follows:

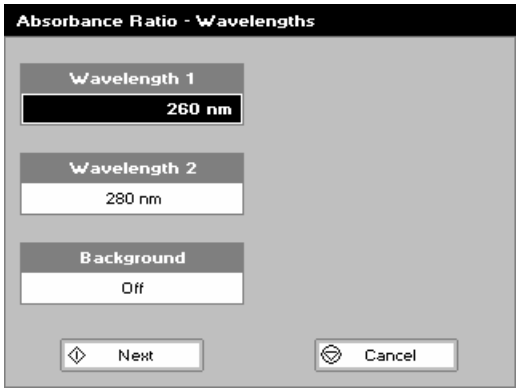

Step 1
Enter the first wavelength by using the keypad numbers or the left and right arrows.
Press the down arrow.
Step 2
Enter the second wavelength as above.
Press the down arrow.
Step 3
Select whether a background correction is applied to both wavelengths 1 and 2 using the left and right arrows.
Step 4 (If background correction is On)
Enter the third wavelength, from which the background correction will be obtained).
Step 5
Press Next ◈ to enter the Parameters screen
OR
Press Cancel ⊽ to return to the Applications Folder.

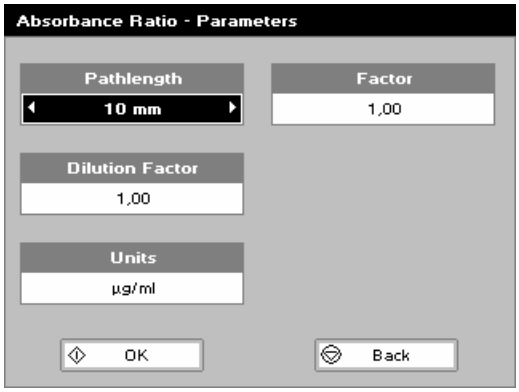

Absorbance Ratio – Parameters Screen
Step 6
Select the pathlength (5 or 10 mm) using the left and right arrows.
Press the down arrow.
Step 7 (Dilution Factor known)
Enter a dilution factor by using the keypad numbers within the range 1.00 – 9999.
OR
Step 7 (Calculate Dilution Factor)
Press the options key: ☒☒☑.
Enter the volume of the sample (range 0.01 – 9999), using the keypad numbers.
Press the down arrow.
Enter the volume of diluent (range 0.01-9999) by using the keypad numbers.
Press OK ◈ to calculate the dilution factor and return to the Parameters screen (or press Back ⊽ to cancel selections).

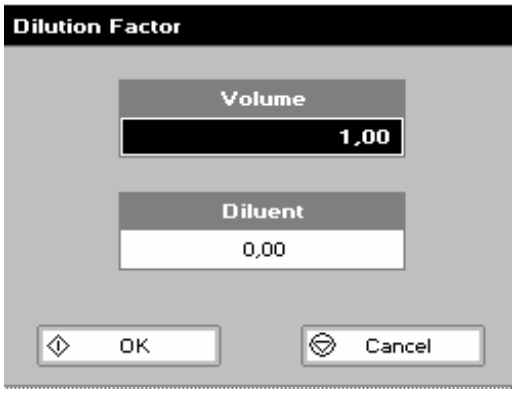

Step 8
Select units of measurement, using left and right arrows. Options are: µg/ml, ng/µl, µg/µl.
Press the down arrow.
Step 9
Enter the factor using the keypad numbers (Range 0.001 to 9999).
Press OK ◈ to enter the results screen or Cancel ⊽ to return to the Applications Folder.

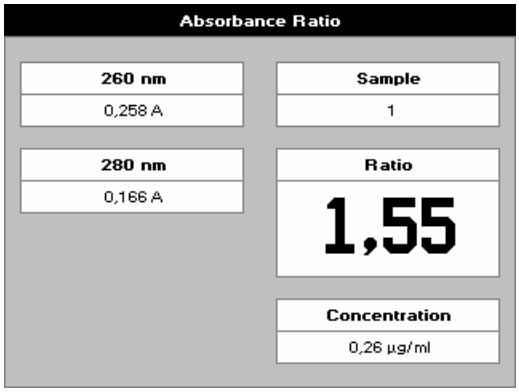

Results Screen
Step 10
Insert the reference. Press 0A/100% key. This will be used for all subsequent samples until changed.
Step 11
Insert sample and press ⓘ.

Repeat step 11 for all samples.

The absorbance at selected wavelengths is measured and the ratio between wavelengths 1 and 2 is calculated (both corrected by the background wavelength value if this was selected).

Press ▽ to return to the Applications Folder.

Press ☒☒☑ to display available Options which are described below.

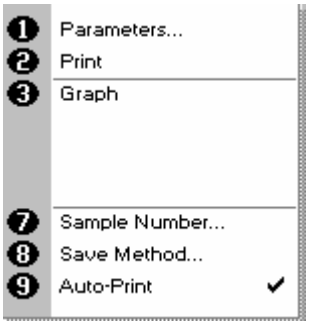

Options (select using key pad numbers)
1. Return to parameters screen (step 1 above).
2. Print result via selected method.
3. Toggle graph on/off. Graph shows a wavescan plot across the selected wavelengths in place of the individual wavelength.
7. Sample number – add a prefix to the sample number and reset the incrementing number to the desired value.
8. Save method – use the left and right arrows to select a folder to store in (Favorites/Methods 1-9), press the down arrow and enter name.
9. Auto-print – toggles auto-print on/off.

Exit options by pressing ▽, or wait.

THE LIFE SCIENCE FOLDER

Life Science Folder

This contains three sub folders; Nucleic Acids, Protein and Cell Count. Contents of these sub folders are detailed below:

1. Nucleic Acids	1	DNA	Concentration and purity check for DNA samples
	2	RNA	Concentration and purity check for RNA samples
	3	Oligo	Concentration and purity check for oligo samples
2. Protein	1	UV protein (Christian Warburg)	Protein determination at 280nm
	2	BCA	Protein determination at 562nm
	3	Bradford	Protein determination at 595nm
	4	Lowry	Protein determination at 750nm
	5	Biuret	Protein determination at 546nm
3. Cell Count	1	OD600	Cell culture OD600 with correction factor

DNA, RNA and oligonucleotide characterization

Nucleic Acid Quantification (NAQ)

- Nucleic acids can be quantified at 260 nm because it is well established that a solution of DNA in a 10 mm pathlength cell with an optical density of 1.0 has a concentration of 50, or 40 µg/ml in the case of RNA. Oligonucleotides have a corresponding factor of 33 µg/ml, although this does vary with base composition; this can be calculated if the base sequence is known.
  Concentration = Abs260 * Factor
- The instrument uses factors 50, 40 and 33 as defaults for DNA, RNA and oligonucleotides, respectively, and can compensate for dilution and use of cells which do not have 10 mm pathlength by entering dilution factor and cell pathlength.

Nucleic Acid Purity Checks

- Nucleic acids extracted from cells are accompanied by protein, and extensive purification is required to separate the protein impurity. The 260/280 ratio gives an indication of purity; it is only an indication, however, and not a definitive assessment. Pure DNA and RNA preparations have expected ratios of ≥ 1.8 and ≥ 2.0, respectively; deviations from this indicate the presence of impurity in the sample, but care must be taken in interpretation of results.
- The 260 nm reading is taken near the top of a broad peak in the Absorbance spectrum for nucleic acids, whereas the 280 nm reading is taken on a steep slope (i.e. small changes in wavelength cause large changes in absorbance). Consequently, small variations in wavelength at 280 nm will have a greater effect on the 260/280 ratio than variations will at 260 nm. Thus different instruments may give slightly different ratios due to variations in wavelength accuracy, however, each instrument will give consistent results within itself.
- Concentration also affects 260/280 readings. If a solution is too dilute, the readings will be at the instrument's detection limit, and results may vary as there is less distinction of the 260 peak and 280 slope from the background absorbance. This is one reason why the Abs260 value should be greater than 0.1 for accurate measurements.
- An elevated absorbance at 230 nm can indicate the presence of impurities as well; 230 nm is near the absorbance maximum of peptide bonds and also indicates buffer contamination since Tris, EDTA and other buffer salts absorb at this wavelength. When measuring RNA samples, the 260/230 ratio should be > 2.0; a ratio lower than this is generally indicative of contamination with guanidinium thiocyanate, a reagent commonly used in RNA purification and which absorbs over the 230 - 260 nm range. A wavelength scan of the nucleic acid is particularly useful for RNA samples.
- The instrument can display 260/280 and 260/230 ratios, and compensates for dilution and use of cells that do not have 10 mm pathlength; dilution factor and cell pathlength can be entered.

Use of Background Correction

- Background correction at a wavelength totally separate from the nucleic acid and protein peaks at 260 and 280 nm, respectively, is sometimes used to compensate for the effects of background absorbance. The wavelength used is 320 nm and it can allow for the effects of turbidity, high absorbance buffer solution and the use of reduced aperture cells. The instrument can use background correction.
- If it is used, there will be different results from those when unused, because Abs320 is subtracted from Abs260 and Abs280 prior to use in equations:
  Concentration = (Abs 260 - Abs 320) * Factor
  Abs ratio = (Abs 260 - Abs 320) / (Abs 280 - Abs 320)
  Abs ratio = (Abs 260 - Abs 320) / (Abs 230 - Abs 320)
- If your laboratory has not used background correction before, set this option to NO.
- The use of background correction can remove variability due to handling effects of low volume disposable cells.

Spectral scan of nucleic acid

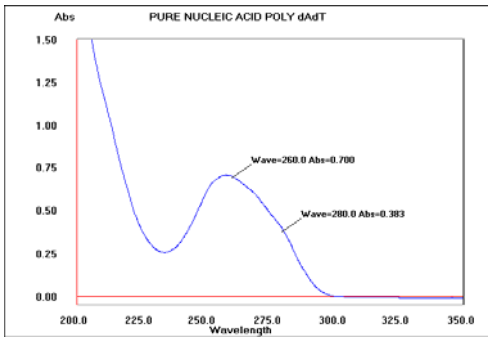

Note:

- absorbance maximum near 260 nm and absorbance minimum near 230 nm
- flat peak near 260 nm and steep slope at 280 nm
- very little absorbance at 320 nm

1: DNA
The procedure is as follows:

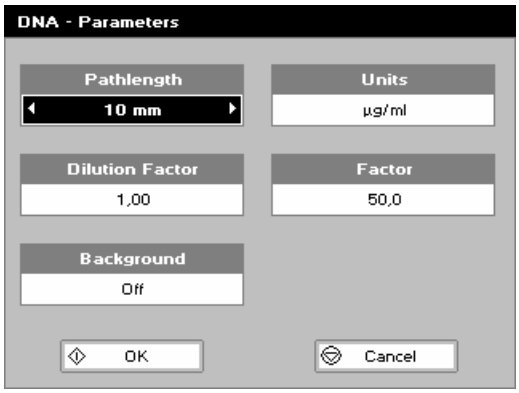

Step 1
Press 1 to select DNA mode.
Step 2
Select path length using the left and right arrows. Options are 5 or 10 mm.
Press the down arrow.
Step 3 (dilution factor known)
Enter the dilution factor using the keypad numbers. Range 1.00 to 9999. Use the C button to backspace and clear the last digit entered.
OR
Step 3 (calculate dilution factor)
Press ☒☒☑ to enter the dilution factor screen.
Enter the volume of the sample using the keypad numbers. Range 0.01 to 9999.
Press the down arrow.
Enter the volume of the diluent using the keypad numbers. Range 0.01 to 9999.
Press ◈ to calculate the dilution factor and return to the Parameters screen.
OR Press ⊘ to cancel the selections and return to the Parameters screen.
Step 4
Select whether the background correction at 320 nm is used or not with the left and right arrows.
Press the down arrow.
Step 5
Select the units of measurement using the left and right arrows. Options: µg/ml, ng/µl, µg/µl.
Press the down arrow.
Step 6
Enter the factor using the keypad numbers. Default value is 50, range is 0.01 to 9999.
Step 7
Press OK ◈ to enter the Results screen
OR
Cancel ⊘ to return to the Nucleic Acids folder

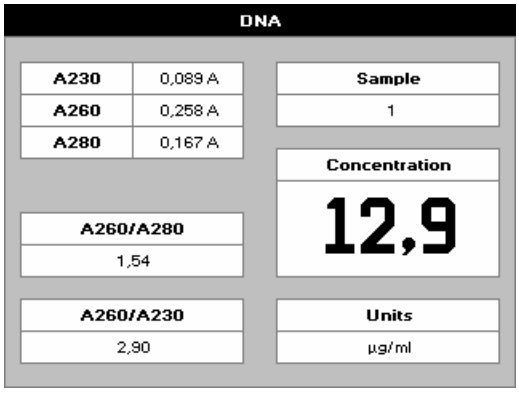

Results Screen
Step 8
Insert the reference. Press 0A/100%T Key. This will be used for all subsequent samples until changed.
Step 9
Insert sample and press ◈. This measures at the selected wavelengths and displays the results. The ratio of wavelengths 1 and 2 Absorbencies are calculated (both corrected by the background wavelength value if selected). Gives concentration based on Absorbance at wavelength 1.

Repeat step 9 for all samples.

Press ⊘ to return to the Nucleic acid folder.

Press ☒☒☑ to display available Options which are described below.

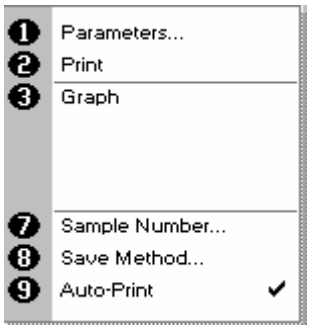

Options (select using key pad numbers)

1. Return to parameters screen (step 1 above).
2. Print result via selected method.
3. Toggle graph on/off. The graph shows a wavescan plot across the range 220 nm to 320 nm with cursors denoting 230, 260, 280 and (if background correction selected) 320 nm.
7. Sample number – add a prefix to the sample number and reset the incrementing number to the desired value.
8. Save method – use the left and right arrows to select a folder to store in (Favorites/Methods 1-9), press the down arrow and enter name.
9. Auto-print – toggles auto-print on/off.

Exit options by pressing ⓥ, or wait.

2: RNA
The procedure is as follows:

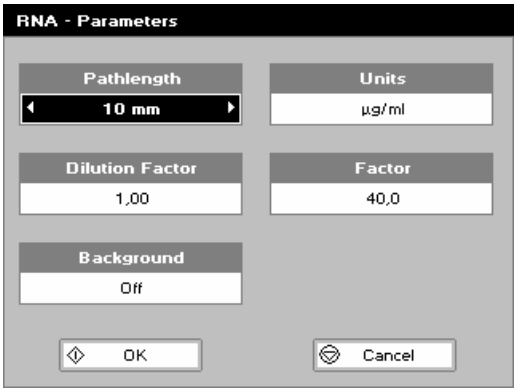

Step 1
Press 2 to select RNA mode.
Step 2
Select path length using the left and right arrows. Options are 5 or 10 mm.
Press the down arrow.
Step 3 (dilution factor known)
Enter the dilution factor using the keypad numbers. Range 1.00 to 9999. Use the C button to backspace and clear the last digit entered.
OR
Step 3 (calculate dilution factor)
Press ☒☒☑ to enter the dilution factor screen.
Enter the volume of the sample using the keypad numbers. Range 0.01 to 9999.
Press the down arrow.
Enter the volume of the diluent using the keypad numbers. Range 0.01 to 9999.
Press ◈ to calculate the dilution factor and return to the Parameters screen.
OR Press ⊘ to cancel the selections and return to the Parameters screen.
Step 4
Select whether the background correction at 320 nm is used or not with the left and right arrows.
Press the down arrow.
Step 5
Select the units of measurement using the left and right arrows. Options: µg/ml, ng/µl, µg/µl.
Press the down arrow.
Step 6
Enter the factor using the keypad numbers. Default value is 40, range is 0.01 to 9999.
Step 7
Press OK ◈ to enter the Results screen
OR
Cancel ⊘ to return to the Nucleic Acids folder

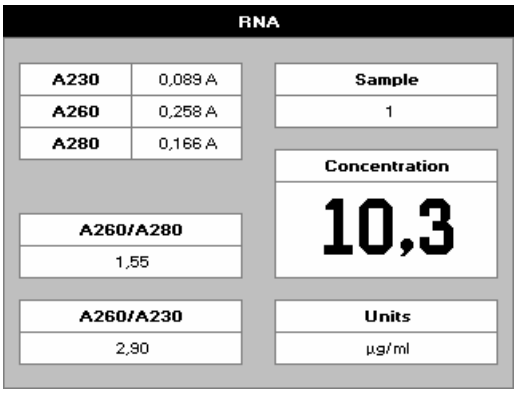

Results Screen
Step 8
Insert the reference. Press 0A/100%T Key. This will be used for all subsequent samples until changed.
Step 9
Insert sample and press ◈. This measures at the selected wavelengths and displays the results. The ratio of wavelengths 1 and 2 absorbencies are calculated (both corrected by the background wavelength value if selected). Gives concentration based on absorbance at wavelength 1.

Repeat step 9 for all samples.

Press ⊘ to return to the Nucleic acid folder.

Press ☒☒☑ to display available Options which are described below.

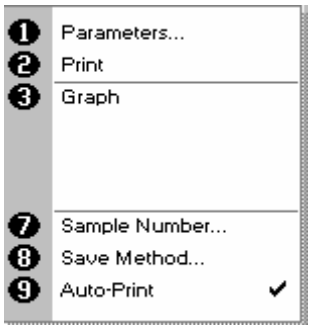

Options (select using key pad numbers)

1. Return to parameters screen (step 1 above).
2. Print result via selected method.
3. Toggle graph on/off. The graph shows a wavescan plot across the range 220 nm to 320 nm with cursors denoting 230, 260, 280 and (if background correction selected) 320 nm.
7. Sample number – add a prefix to the sample number and reset the incrementing number to the desired value.
8. Save method – use the left and right arrows to select a folder to store in (Favorites/Methods 1-9), press the down arrow and enter name.
9. Auto-print – toggles auto-print on/off.

Exit options by pressing ⊽, or wait.

3: Oligo
The procedure is as follows:

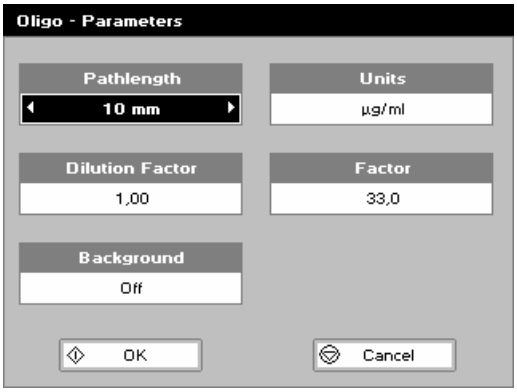

Step 1
Press 3 to select Oligo mode.
Step 2
Select path length using the left and right arrows. Options are 5 or 10 mm.
Press the down arrow.
Step 3 (dilution factor known)
Enter the dilution factor using the keypad numbers. Range 1.00 to 9999. Use the C button to backspace and clear the last digit entered.
OR
Step 3 (calculate dilution factor)
Press ☒☒☑ to enter the dilution factor screen.
Enter the volume of the sample using the keypad numbers. Range 0.01 to 9999.
Press the down arrow.
Enter the volume of the diluent using the keypad numbers. Range 0.01 to 9999.
Press ◈ to calculate the dilution factor and return to the Parameters screen.
OR Press ▽ to cancel the selections and return to the Parameters screen.
Step 4
Select whether the background correction at 320 nm is used or not with the left and right arrows.
Press the down arrow.
Step 5
Select the units of measurement using the left and right arrows. Options: µg/ml, ng/µl, µg/µl and pmol/µl. If pmol/µl is selected the factor changes to a selection table denoting the ratios of the 4 bases in the structure.
Press the down arrow.

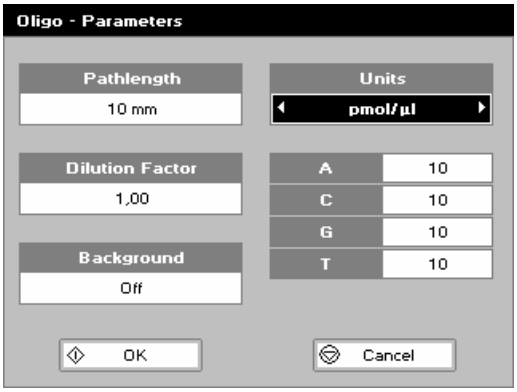

Step 6 (units not pmol/µl)
Enter the factor using the keypad numbers. Default value is 33, range is 0.01 to 9999.
OR
Step 6 (units pmol/µl)
Enter the proportions of bases present using the keypad numbers and up and down arrows to move between boxes. Default is 10 for each, range is 0 to 9999.
Step 7
Press OK ◈ to enter the Results screen
OR
Cancel ▽ to return to the Nucleic Acids folder

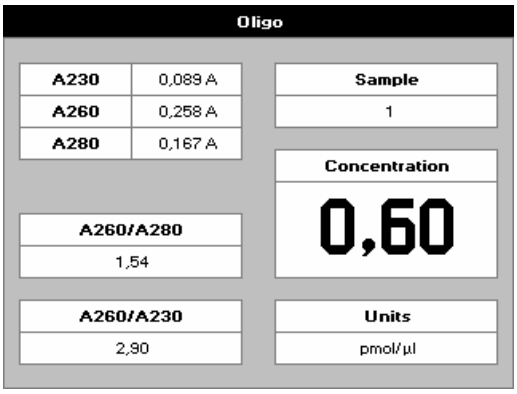

Results Screen
Step 8
Insert the reference. Press 0A/100%T Key. This will be used for all subsequent samples until changed.

Step 9
Insert sample and press ◈. This measures at the selected wavelengths and displays the results. The ratio of wavelengths 1 and 2 absorbencies are calculated (both corrected by the background wavelength value if selected). Gives concentration based on absorbance at wavelength 1.
Repeat step 9 for all samples.

Press ▽ to return to the Nucleic acid folder.

Press ☒☒☑ to display available Options which are described below.

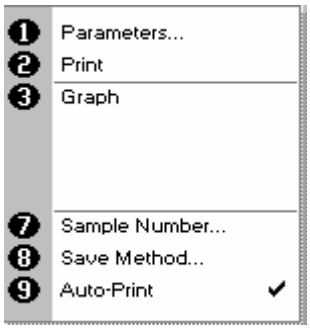

Options (select using key pad numbers)
1. Return to parameters screen (step 1 above).
2. Print result via selected method.
3. Toggle graph on/off. The graph shows a wavescan plot across the range 220 nm to 320 nm with cursors denoting 230, 260, 280 and (if background correction selected) 320 nm.
7. Sample number – add a prefix to the sample number and reset the incrementing number to the desired value.
8. Save method – use the left and right arrows to select a folder to store in (Favorites/Methods 1-9), press the down arrow and enter name.
9. Auto-print – toggles auto-print on/off.

Exit options by pressing ▽, or wait.

Protein Determination

Protein Determination at 280 nm

- Protein can be determined at 280 nm due to absorption by tyrosine, tryptophan and phenylalanine amino acids; Abs 280 varies greatly for different proteins due to their amino acid content, and consequently the specific absorption value for a particular protein must be determined.
- The presence of nucleic acid in the protein solution can have a significant effect due to strong nucleotide absorbance at 280 nm. This can be compensated by measuring Abs 260, and applying the equation of Christian and Warburg for the protein crystalline yeast enolase (Biochemische Zeitung 310, 384 (1941)):
  Protein (mg/ml) = 1.55 * Abs 280 - 0.76 * Abs 260
  or, Protein conc. = (Factor 1 * Abs 280) - (Factor 2 * Abs 260)
- This equation can be applied to other proteins if the corresponding factors are known. The instrument can determine protein concentration at 280 nm and uses the above equation as default; the factors can be changed, and the use of background correction at 320 nm is optional.
- To customize the equation for a particular protein, the absorbance values at 260 and 280 nm should be determined at known protein concentrations to generate simple simultaneous equations; solving these provides the two coefficients. In cases where Factor 2 is found to be negative, it should be set to zero since it means there is no contribution to the protein concentration due to absorbance at 260 nm.
- Set Factor 2 = 0.00 for direct λ280 UV protein measurement; Factor 1 is based on the extinction coefficient of the protein. If BSA (bovine serum albumin) is an acceptable standard, setting Factor 1 = 1.115 will give linear results from 0 to 0.8 mg/ml protein.
  Protein (mg/ml) = 1.115 * Abs 280
- Rapid measurements such as this at Abs 280 are particularly useful after isolation of proteins and peptides from mixtures using spin and HiTrap columns by centrifuge and gravity, respectively.

Protein Determination at 595, 546, 562 and 750 nm

- The Bradford method depends on quantitating the binding of a dye, Coomassie Brilliant Blue, to an unknown protein and comparing this binding to that of different, known concentrations of a standard protein at 595 nm; this is usually BSA, bovine serum albumin.
- The Biuret method depends on reaction between Cupric ions and peptide bonds in an alkali solution, resulting in the formation of a complex absorbing at 546 nm.
- The BCA method also depends on reaction between cupric ions and peptide bonds, but in addition combines this reaction with the detection of cuprous ions using bicinchoninic acid (BCA), giving an absorbance maximum at 562 nm. The BCA process is less sensitive to the presence of detergents used to break down cell walls.
- The Lowry method depends on quantifying the color obtained from the reaction of Folin-Ciocalteu phenol reagent with the tyrosyl residues of an unknown protein and comparing with those derived from a standard curve of a standard protein at 750 nm; this is usually BSA, bovine serum albumin
- Detailed protocols are supplied with these assay kits, and must be closely followed to ensure accurate results are obtained.
- The use of plastic disposable cells is recommended. To use a zero concentration standard include it in the number of standards to be entered and enter 0.00 for concentration; use this when required to enter standard 1.
- A linear regression analysis of the calibration standard data points is calculated; the result, together with the correlation coefficient, can be printed out. A correlation coefficient of between 0.95 and 1.00 indicates a good straight line.

1: Protein UV

This is the Christian and Warburg assay discussed previously. The procedure is as follows:

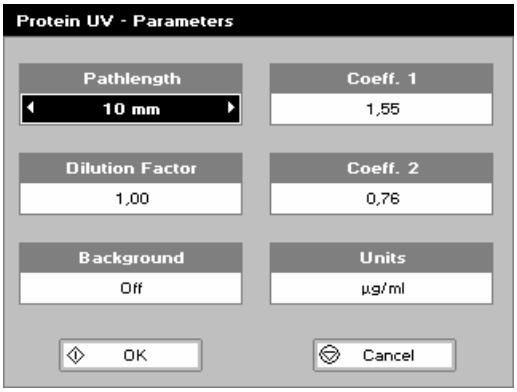

Step 1
Press 1 to select Protein UV mode.
Step 2
Select path length using the left and right arrows. Options are 5 or 10 mm.
Press the down arrow.
Step 3 (dilution factor known)
Enter the dilution factor using the keypad numbers. Range 1.00 to 9999. Use the C button to backspace and clear the last digit entered.
OR
Step 3 (calculate dilution factor)
Press ☒☒☑ to enter the dilution factor screen.
Enter the volume of the sample using the keypad numbers. Range 0.01 to 9999.
Press the down arrow.
Enter the volume of the diluent using the keypad numbers. Range 0.01 to 9999.
Press ◈ to calculate the dilution factor and return to the Parameters screen.
OR Press ⊘ to cancel the selections and return to the Parameters screen.
Step 4
Select whether the background correction at 320 nm is used or not with the left and right arrows.
Press the down arrow.
Step 5
Enter co-efficient 1 (280 nm) using the keypad numbers. Default value is 1.55, range is 1.00 to 9999.
Press the down arrow.
Step 6
Enter co-efficient 2 (260 nm) using the keypad numbers. Default value is 0.76. Range is 1.00 to 9999.
Press the down arrow.
Step 7
Select the units of measurement using the left and right arrows. Options: µg/ml, ng/µl and µg/µl.
Step 8
Press OK ◈ to enter the Results screen
OR
Cancel ⊘ to return to the Protein folder

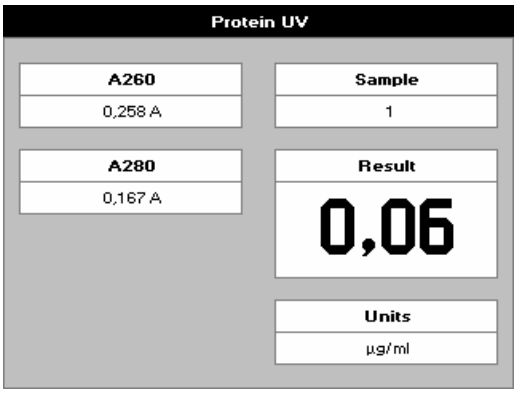

Results Screen
Step 9
Insert the reference. Press 0A/100%T Key. This will be used for all subsequent samples until changed.

Step 10

Insert sample and press ◈. This measures at both 260 and 280 nm wavelengths and displays the result. Protein concentration is calculated (corrected by background wavelength value if selected).
Repeat step 10 for all samples.

Press ▽ to return to the Protein folder.

Press ☒☒☑ to display available Options which are described below.

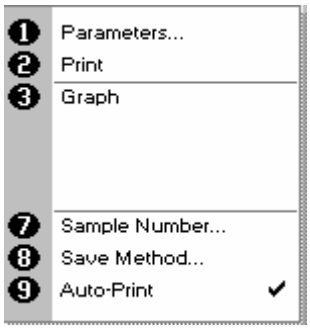

Options (select using key pad numbers)
1. Return to parameters screen (step 1 above).
2. Print result via selected method.
3. Toggle graph on/off. The graph shows a wavescan plot across the range 250 nm to 330 nm with cursors denoting 230, 260, 280 and (if background correction selected) 320 nm.
7. Sample number – add a prefix to the sample number and reset the incrementing number to the desired value.
8. Save method – use the left and right arrows to select a folder to store in (Favorites/Methods 1-9), press the down arrow and enter name.
9. Auto-print – toggles auto-print on/off.

Exit options by pressing ▽, or wait.

2: BCA

The procedure is as follows:

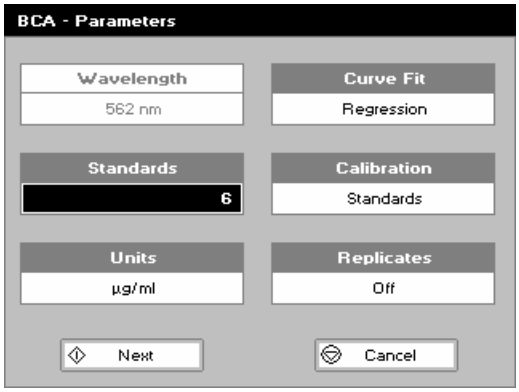

Step 1
Press 2 to select BCA mode.
Step 2
Wavelength for this stored method is pre-set to 562nm
Step 3
Enter the number of standard concentration points (1-9) to be used in the curve using the keypad numbers or left and right arrows.
Press the down arrow.

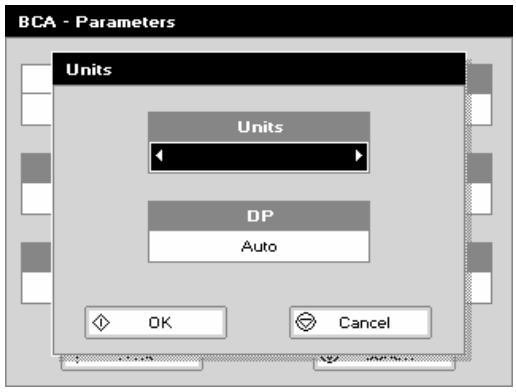

Step 4
Units: The user can enter a text string up to 8 characters long. To access a list of pre-defined units press the Options key ☒☒☑ and then use the left/right arrows (µg/ml, µg/µl, pmol/µl, mg/dl, mmol/l, µmol/l, g/l, mg/l, µg/l, U/l, %, ppm, ppb, conc or none). These units can also be edited once OK is pressed.
This screen also allows the number of displayed decimal points (DP) to be selected, from 0 to 2 Note that the result will always be fixed to 5 significant figures regardless of how many decimal points are selected (so 98768.2 will display as 98768 even with 1 decimal point selected).
Press OK ◈ to store the chosen parameters or Cancel ▽.

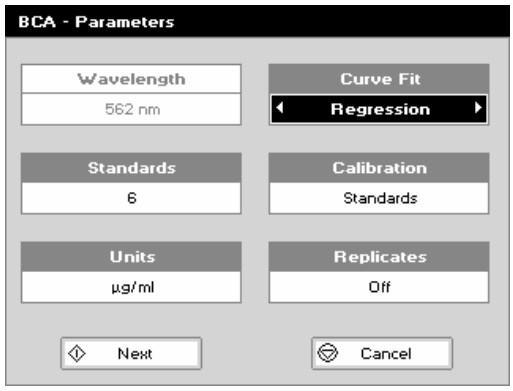

Step 5
Enter the type of curve fit. Options are straight line regression, zero regression (forces the straight line through the origin), interpolated or cubic spline.
Press the down arrow.
Step 6
Select the calibration mode, either standards (measure prepared standards) or manual (keypad data entry)
Step 7 (if standards selected)
Select the number of replicates using the left and right arrows. This determines the number of standards to be measured and averaged at each standard concentration point. Can be OFF (1), 2 or 3.
Step 8
Press Next ◈ to enter the Standards screen
OR
Press Cancel ▽ to cancel selections and return to the Protein folder.

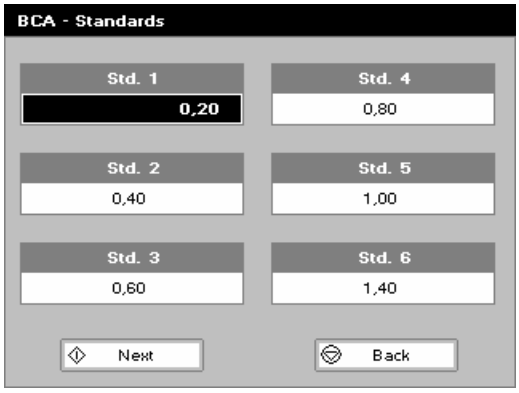

Standards Screen
Step 9
Enter the concentration values by using the keypad numbers and the up and down arrows to move between the different standard boxes. Range 0.001 to 9999. C button backspaces and clears the last digit entered.
Step 10
Press Next ◈ to enter the Calibration screen. If there are duplicate or non-monotonic (increasing) entries the unit will beep and highlight the incorrect entry.
OR
Press Back ▽ to return to the Parameter screen.

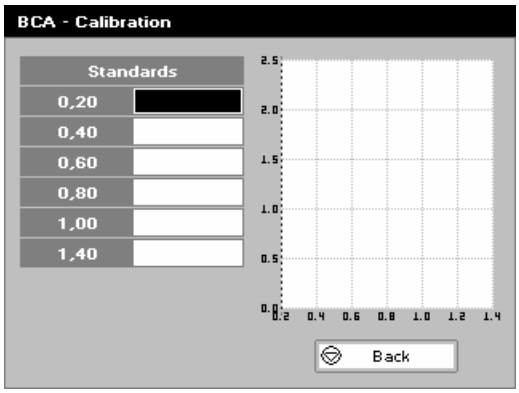

Calibration Screen (replicates off)
This shows the calibration values and allows standards to be measured.

Step 11
Insert the reference sample. Press 0A/100% key.
This will be used for all subsequent samples until changed.

Step 12
Insert the standard (use C to clear previously stored results before measuring)

Press ◈ to measure the standard and store the result.

Repeat step 12 for all standards. A graph will display the results and the fitted curve as the measurements are made.

Use the up and down arrows to select a standard to be repeated if a poor reading has been obtained. Use C to clear the previous reading.

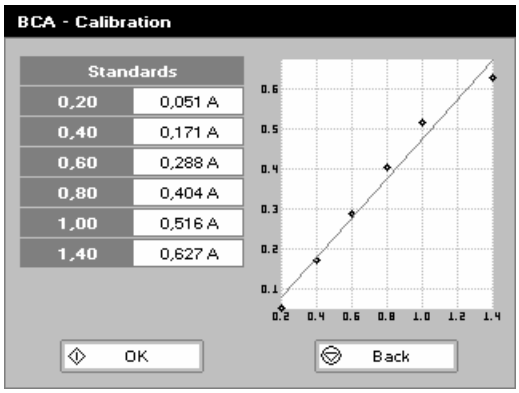

Step 13
When all standards are measured the OK box appears. Press ◈ to accept the calibration an go to the Results screen (see below)
OR
Press Back ▽ to cancel selections and return to the Standards screen.

Calibration Screen (replicates on)
This shows the calibration values and allows standards to be measured.

Step 11
Insert the reference. Press 0A/100% key.
This will be used for all subsequent samples until changed.

Step 12
Press ◈ to display the replicate entry boxes. Use C to clear previously stored results before measuring.

Insert the standard and press ◈ to measure the standard and store the result.

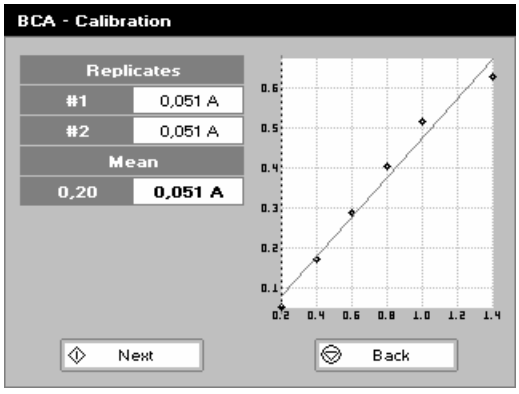

Repeat for all replicates and standards.

A graph will display the results and the fitted curve as the measurements are input.
Use the up and down arrows to select a standard to be repeated if a poor reading has been obtained. Use C to clear the previous reading.

Step 13
Press ◈ to accept the calibration and go to the Results screen (see below)
OR
Press Back ▽ to return to the Standards screen.

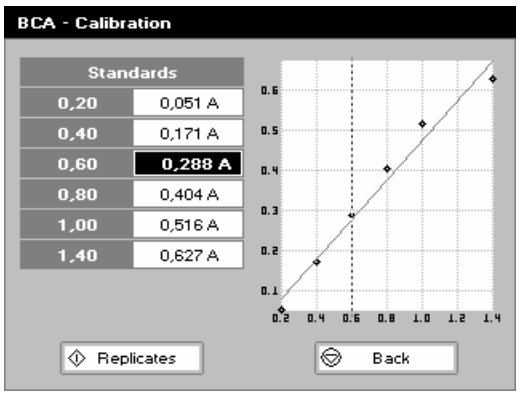

Calibration (Manual entry)
Shows previously entered calibration values and allows values to be entered via the keypad.
The highlighted box can be edited in order to enter an absorbance value corresponding to a given concentration value using the keypad numbers. Range 0.001 to 9999. Use C to backspace and clear the last digit entered and the up and down arrows to move between boxes.

Press OK ◈ to accept the calibration and go to the Results screen (see below)
OR
Press Back ▽ to return to the Standards screen.

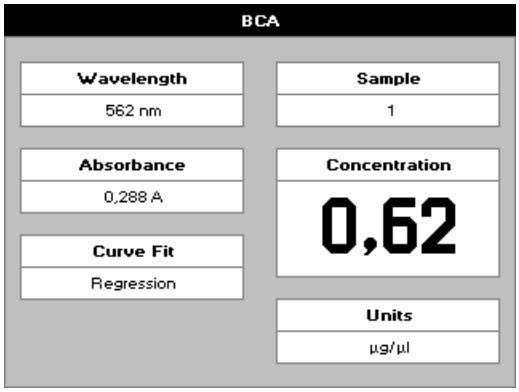

Results screen
Step 14
Insert the reference and press the 0A/100%T key. This will be used for all subsequent samples until changed.
Step 15
Insert the sample and press ◈.
The concentration of the sample is taken and displayed.
Repeat step 15 for all samples.
Press ▽ to return to the Protein Folder.

Press ☒☒☑ to display available Options which are described below.

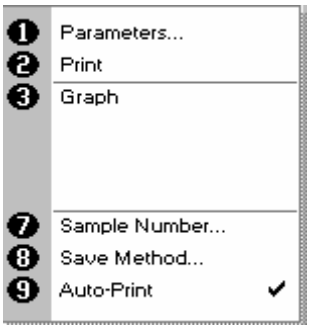

Options (select using key pad numbers)
1. Return to parameters screen (step 1 above).
2. Print result via selected method.
3. Toggle graph on/off. Displays the calibration graph, cursors give values for last measured sample.
7. Sample number – add a prefix to the sample number and reset the incrementing number to the desired value.
8. Save method – use the left and right arrows to select a folder to store in (Favorites/Methods 1-9), press the down arrow and enter name.
9. Auto-print – toggles auto-print on/off.

Exit options by pressing ▽, or wait.

3: Bradford

The procedure is as follows:

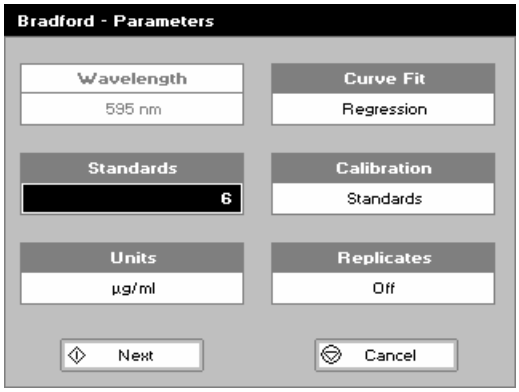

Step 1
Press 3 to select Bradford method.
Step 2
Wavelength for this stored method is pre-set to 595 nm.
Step 3
Enter the number of standard concentration points (1-9) to be used in the curve using the keypad numbers or left and right arrows.
Press the down arrow.

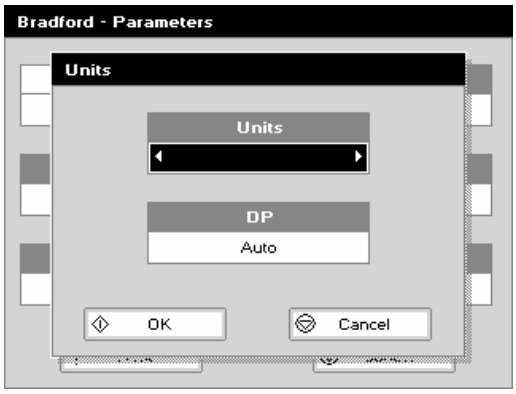

Step 4
Units: The user can enter a text string up to 8 characters long. To access a list of pre-defined units press the Options key ☒☒☑ and then use the left/right arrows (µg/ml, µg/µl, pmol/µl, mg/dl, mmol/l, µmol/l, g/l, mg/l, µg/l, U/l, %, ppm, ppb, conc or none). These units can also be edited once OK is pressed.
This screen also allows the number of displayed decimal points (DP) to be selected, from 0 to 2 Note that the result will always be fixed to 5 significant figures regardless of how many decimal points are selected (so 98768.2 will display as 98768 even with 1 decimal point selected).
Press OK ◈ to store the chosen parameters or Cancel ⊘.

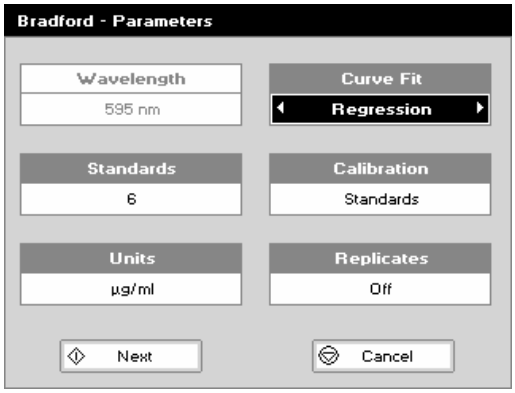

Step 5
Enter the type of curve fit. Options are: straight line regression, zero regression (forces the straight line through the origin), interpolated or cubic spline.
Press the down arrow.
Step 6
Select the calibration mode, either standards (measure prepared standards) or manual (keypad data entry)
Step 7 (if standards selected)
Select the number of replicates using the left and right arrows. This determines the number of standards to be measured and averaged at each standard concentration point. Can be OFF (1), 2 or 3.
Step 8
Press Next ◈ to enter the Standards screen
OR
Press Cancel ⊘ to cancel selections and return to the Protein folder.

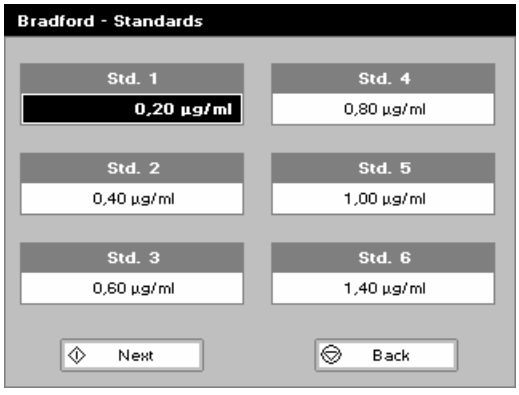

Standards Screen
Step 9
Enter the concentration values by using the keypad numbers and the up and down arrows to move between the different standard boxes. Range 0.001 to 9999. C button backspaces and clears the last digit entered.
Step 10
Press Next ◈ to enter the Calibration screen. If there are duplicate or non-monotonic (increasing) entries the unit will beep and highlight the incorrect entry.
OR
Press Back ⊘ to return to the Parameter screen

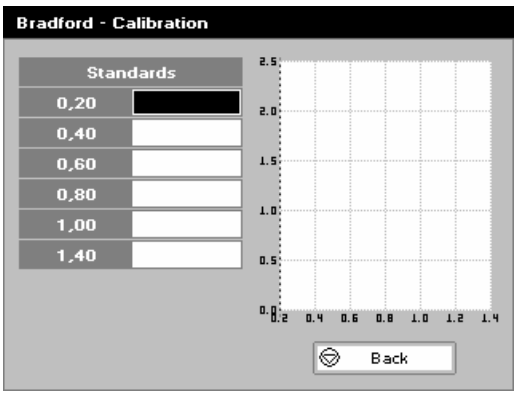

Calibration Screen (replicates off)
This shows the calibration values and allows standards to be measured.

Step 11
Insert the reference. Press 0A/100% key.
This will be used for all subsequent samples until changed.

Step 12
Insert the standard (use C to clear previously stored results before measuring)
Press ◈ to measure the standard and store the result.

Repeat step 12 for all standards. A graph will display the results and the fitted curve as the measurements are made.

Use the up and down arrows to select a standard to be repeated if a poor reading has been obtained. Use C to clear the previous reading.

Step 13
When all standards are measured the OK box appears. Press ◈ to accept the calibration an go to the Results screen (see below)
OR
Press Back ▽ to cancel selections and return to the Standards screen.

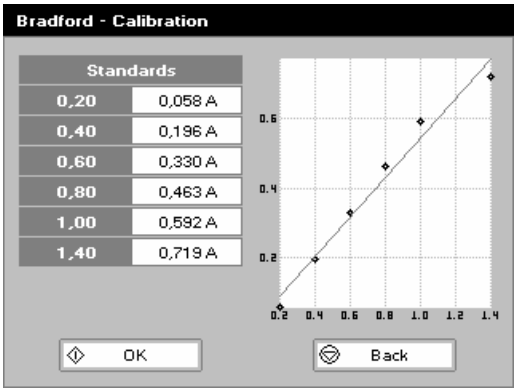

Calibration Screen (replicates on)
This shows the calibration values and allows standards to be measured.

Step 11
Insert the reference. Press 0A/100% key.
This will be used for all subsequent samples until changed.

Step 12
Press ◈ to display the replicate entry boxes. Use C to clear previously stored results before measuring.
Insert the standard and press ◈ to measure the standard and store the result.

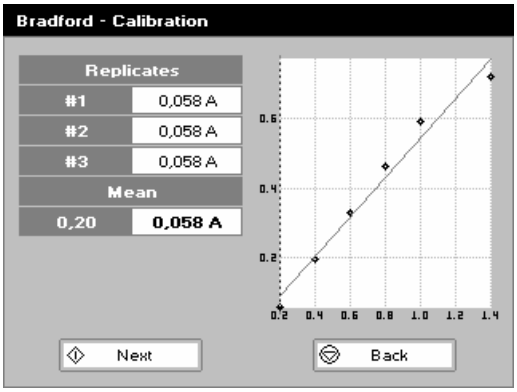

Repeat for all replicates and standards.

A graph will display the results and the fitted curve as the measurements are input.
Use the up and down arrows to select a standard to be repeated if a poor reading has been obtained. Use C to clear the previous reading.

Step 13
Press ◈ to accept the calibration and go to the Results screen (see below)
OR
Press Back ▽ to return to the Standards screen.

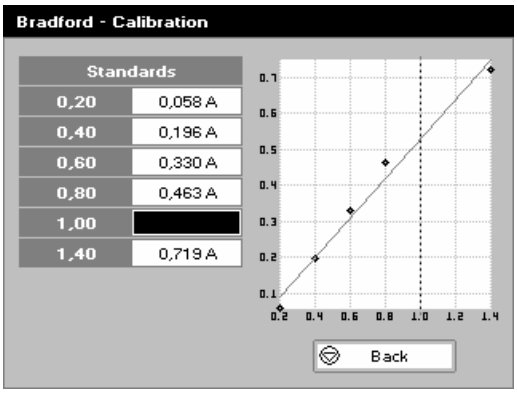

Calibration (Manual entry)
Shows previously entered calibration values and allows values to be entered via the keypad.
The highlighted box can be edited in order to enter an absorbance value corresponding to a given concentration value using the keypad numbers. Range 0.001 to 9999. Use C to backspace and clear the last digit entered and the up and down arrows to move between boxes.

Press OK ◈ to accept the calibration and go to the Results screen (see below)
OR
Press Back ▽ to return to the Standards screen.

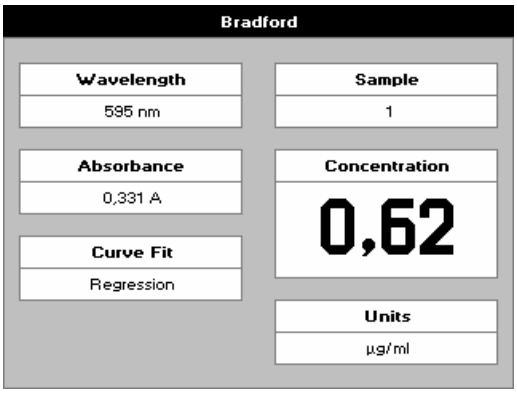

Results screen
Step 14
Insert the reference and press the 0A/100%T key. This will be used for all subsequent samples until changed.
Step 15
Insert the sample and press ◈.
The concentration of the sample is taken and displayed.
Repeat step 15 for all samples.
Press ▽ to return to the Protein Folder.

Press ☒☒☑ to display available Options which are described below.

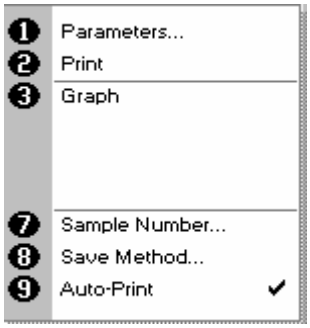

Options (select using key pad numbers)
1. Return to parameters screen (step 1 above).
2. Print result via selected method.
3. Toggle graph on/off. Displays the calibration graph, cursors give values for last measured sample.
7. Sample number – add a prefix to the sample number and reset the incrementing number to the desired value.
8. Save method – use the left and right arrows to select a folder to store in (Favorites/Methods 1-9), press the down arrow and enter name.
9. Auto-print – toggles auto-print on/off.

Exit options by pressing ▽, or wait.

4: Lowry

The procedure is as follows:

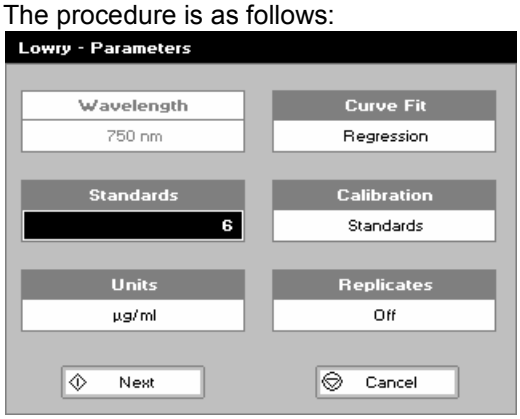

Step 1
Press 4 to select Lowry method.
Step 2
Wavelength for this stored method is pre-set to 750 nm.
Step 3
Enter the number of standard concentration points (1-9) to be used in the curve using the keypad numbers or left and right arrows.
Press the down arrow.

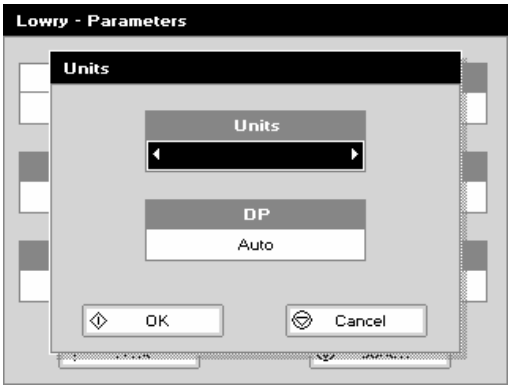

Step 4
Units: The user can enter a text string up to 8 characters long. To access a list of pre-defined units press the Options key ☒☒☑ and then use the left/right arrows (µg/ml, µg/µl, pmol/µl, mg/dl, mmol/l, µmol/l, g/l, mg/l, µg/l, U/l, %, ppm, ppb, conc or none). These units can also be edited once OK is pressed.
This screen also allows the number of displayed decimal points (DP) to be selected, from 0 to 2 Note that the result will always be fixed to 5 significant figures regardless of how many decimal points are selected (so 98768.2 will display as 98768 even with 1 decimal point selected).
Press OK ◈ to store the chosen parameters or Cancel ⊘.

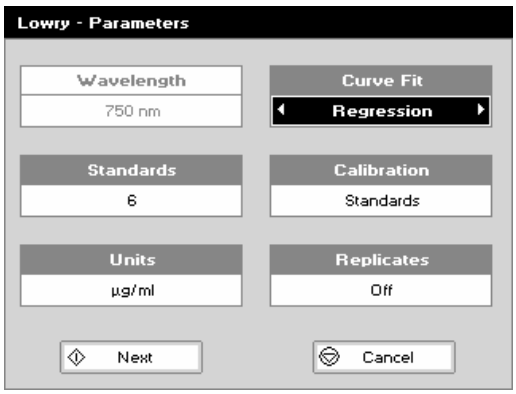

Step 5
Enter the type of curve fit. Options are straight line regression, zero regression (forces the straight line through the origin), interpolated or cubic spline.
Press the down arrow.
Step 6
Select the calibration mode, either standards (measure prepared standards) or manual (keypad data entry)
Step 7 (if standards selected)
Select the number of replicates using the left and right arrows. This determines the number of standards to be measured and averaged at each standard concentration point. Can be OFF (1), 2 or 3.
Step 8
Press Next ◈ to enter the Standards screen
OR
Press Cancel ⊘ to cancel selections and return to the Protein folder.

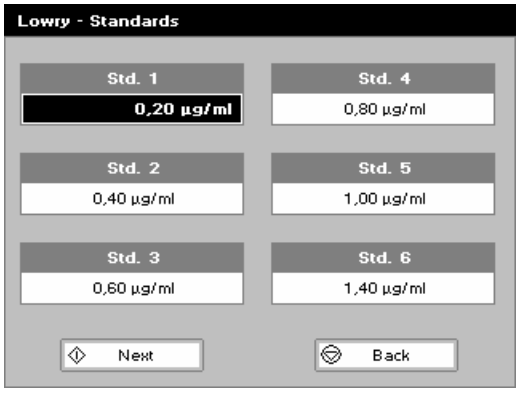

Standards Screen
Step 9
Enter the concentration values by using the keypad numbers and the up and down arrows to move between the different standard boxes. Range 0.001 to 9999. C button backspaces and clears the last digit entered.
Step 10
Press Next ◈ to enter the Calibration screen. If there are duplicate or non-monotonic (increasing) entries the unit will beep and highlight the incorrect entry.
OR
Press Back ⊘ to return to the Parameter screen

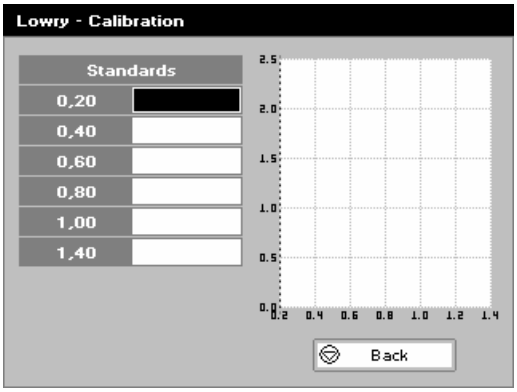

Calibration Screen (replicates off)
This shows the calibration values and allows standards to be measured.

Step 11
Insert the reference. Press 0A/100% key.
This will be used for all subsequent samples until changed.

Step 12
Insert the standard (use C to clear previously stored results before measuring)
Press ◈ to measure the standard and store the result.

Repeat step 12 for all standards. A graph will display the results and the fitted curve as the measurements are made.

Use the up and down arrows to select a standard to be repeated if a poor reading has been obtained. Use C to clear the previous reading.

Step 13
When all standards are measured the OK box appears. Press ◈ to accept the calibration an go to the Results screen (see below)
OR
Press Back ▽ to cancel selections and return to the Standards screen.

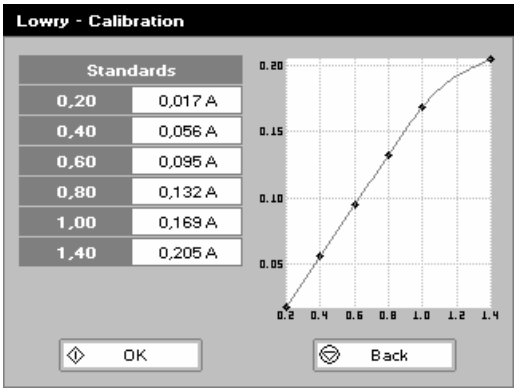

Calibration Screen (replicates on)
This shows the calibration values and allows standards to be measured.

Step 11
Insert the reference sample. Press 0A/100% key.
This will be used for all subsequent samples until changed.

Step 12
Press ◈ to display the replicate entry boxes. Use C to clear previously stored results before measuring.
Insert the standard and press ◈ to measure the standard and store the result.

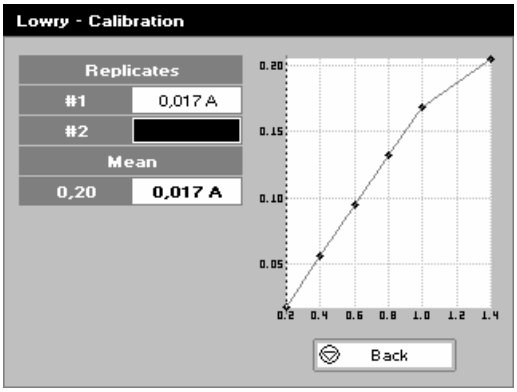

Repeat for all replicates and standards.

A graph will display the results and the fitted curve as the measurements are input.
Use the up and down arrows to select a standard to be repeated if a poor reading has been obtained. Use C to clear the previous reading.

Step 13
Press ◈ to accept the calibration and go to the Results screen (see below)
OR
Press Back ▽ to return to the Standards screen.

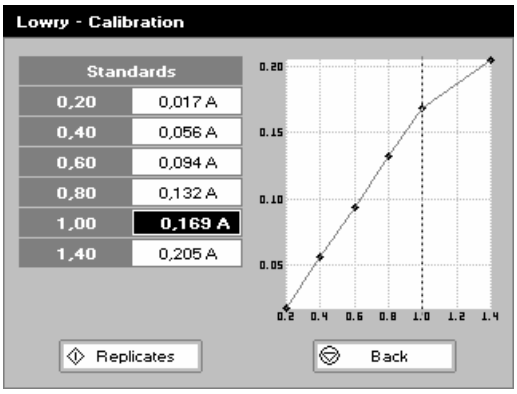

Calibration (Manual entry)
Shows previously entered calibration values and allows values to be entered via the keypad.
The highlighted box can be edited in order to enter an absorbance value corresponding to a given concentration value using the keypad numbers. Range 0.001 to 9999. Use C to backspace and clear the last digit entered and the up and down arrows to move between boxes.

Press OK ◈ to accept the calibration and go to the Results screen (see below)
OR
Press Back ▽ to return to the Standards screen.

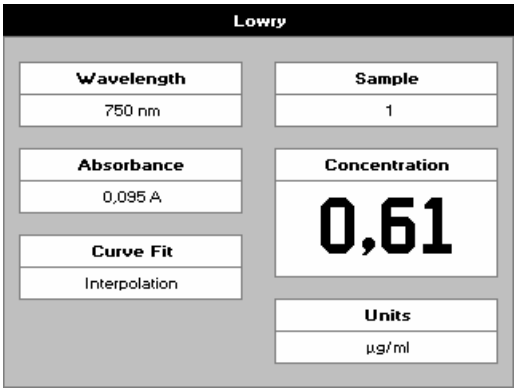

Results screen
Step 14
Insert the reference and press the 0A/100%T key. This will be used for all subsequent samples until changed.
Step 15
Insert the sample and press ◈.
The concentration of the sample is taken and displayed.
Repeat step 15 for all samples.
Press ▽ to return to the Protein Folder.

Press ☒☒☑ to display available Options which are described below.

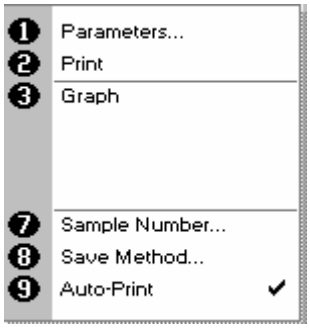

Options (select using key pad numbers)
1. Return to parameters screen (step 1 above).
2. Print result via selected method.
3. Toggle graph on/off. Displays the calibration graph, cursors give values for last measured sample.
7. Sample number – add a prefix to the sample number and reset the incrementing number to the desired value.
8. Save method – use the left and right arrows to select a folder to store in (Favorites/Methods 1-9), press the down arrow and enter name.
9. Auto-print – toggles auto-print on/off.

Exit options by pressing ▽, or wait.

5: Biuret

The procedure is as follows:

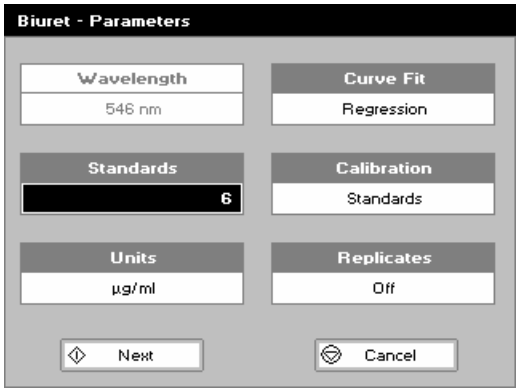

Step 1
Press 5 to select Biuret method.
Step 2
Wavelength for this stored method is pre-set to 546 nm.
Step 3
Enter the number of standard concentration points (1-9) to be used in the curve using the keypad numbers or left and right arrows.
Press the down arrow.

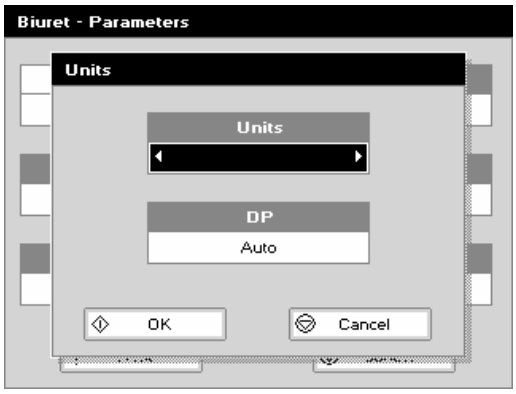

Step 4
Units: The user can enter a text string up to 8 characters long. To access a list of pre-defined units press the Options key ☒☒☑ and then use the left/right arrows (µg/ml, µg/µl, pmol/µl, mg/dl, mmol/l, µmol/l, g/l, mg/l, µg/l, U/l, %, ppm, ppb, conc or none). These units can also be edited once OK is pressed.
This screen also allows the number of displayed decimal points (DP) to be selected, from 0 to 2 Note that the result will always be fixed to 5 significant figures regardless of how many decimal points are selected (so 98768.2 will display as 98768 even with 1 decimal point selected).
Press OK ◈ to store the chosen parameters or Cancel ⊘.

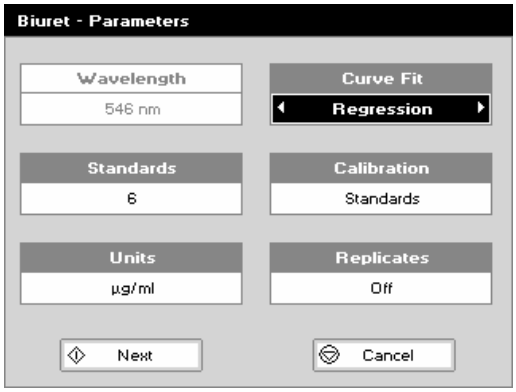

Step 5
Enter the type of curve fit. Options are straight line regression, zero regression (forces the straight line through the origin), interpolated or cubic spline.
Press the down arrow.
Step 6
Select the calibration mode, either standards (measure prepared standards) or manual (keypad data entry)
Step 7 (if standards selected)
Select the number of replicates using the left and right arrows. This determines the number of standards to be measured and averaged at each standard concentration point. Can be OFF (1), 2 or 3.
Step 8
Press Next ◈ to enter the Standards screen
OR
Press Cancel ⊘ to cancel selections and return to the Protein folder.

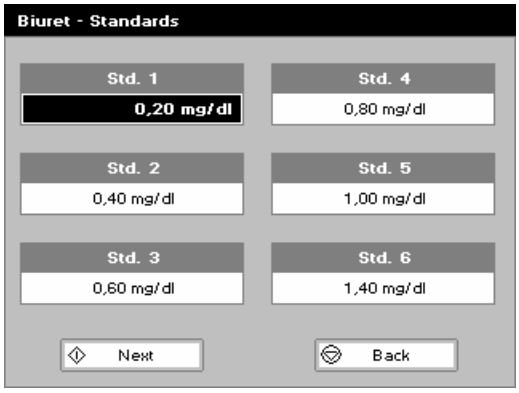

Standards Screen
Step 9
Enter the concentration values by using the keypad numbers and the up and down arrows to move between the different standard boxes. Range 0.001 to 9999. C button backspaces and clears the last digit entered.
Step 10
Press Next ◈ to enter the Calibration screen
OR
Press Back ⊘ to return to the Parameter screen

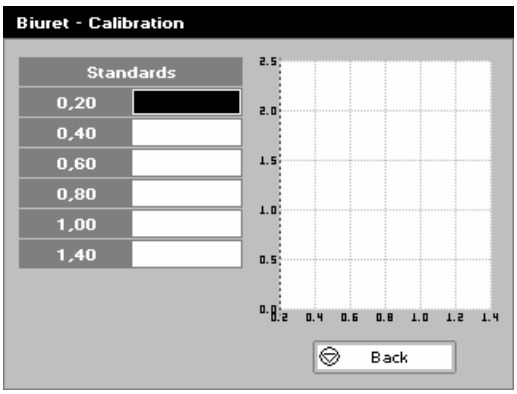

Calibration Screen (replicates off)
This shows the calibration values and allows standards to be measured.

Step 11
Insert the reference. Press 0A/100% key.
This will be used for all subsequent samples until changed.

Step 12
Insert the standard (use C to clear previously stored results before measuring)
Press ◈ to measure the standard and store the result.

Repeat step 12 for all standards. A graph will display the results and the fitted curve as the measurements are made.

Use the up and down arrows to select a standard to be repeated if a poor reading has been obtained. Use C to clear the previous reading.

Step 13
When all standards are measured the OK box appears. Press ◈ to accept the calibration an go to the Results screen (see below)
OR
Press Back ▽ to cancel selections and return to the Standards screen.

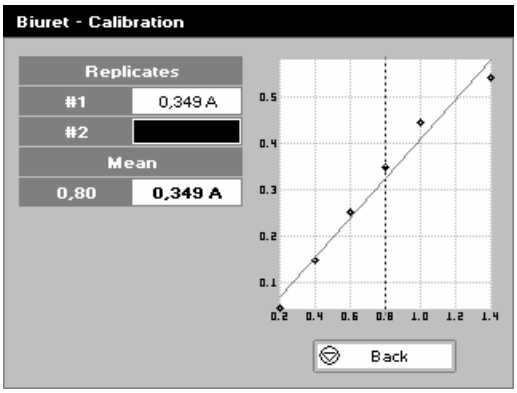

Calibration Screen (replicates on)
This shows the calibration values and allows standards to be measured.

Step 11
Insert the reference. Press 0A/100% key.
This will be used for all subsequent samples until changed.

Step 12
Press ◈ to display the replicate entry boxes. Use C to clear previously stored results before measuring.
Insert the standard and press ◈ to measure the standard and store the result.

Repeat for all replicates and standards.

A graph will display the results and the fitted curve as the measurements are input.
Use the up and down arrows to select a standard to be repeated if a poor reading has been obtained. Use C to clear the previous reading.

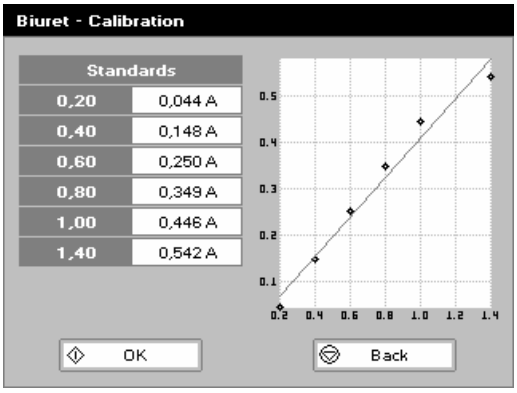

Step 13
Press ◈ to accept the calibration and go to the Results screen (see below)
OR
Press Back ▽ to return to the Standards screen.

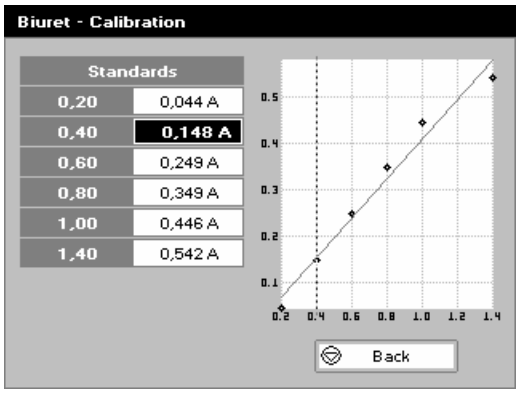

Calibration (Manual entry)
Shows previously entered calibration values and allows values to be entered via the keypad.
The highlighted box can be edited in order to enter an absorbance value corresponding to a given concentration value using the keypad numbers. Range 0.001 to 9999. Use C to backspace and clear the last digit entered and the up and down arrows to move between boxes.

Press OK ◈ to accept the calibration and go to the Results screen (see below)
OR
Press Back ▽ to return to the Standards screen.

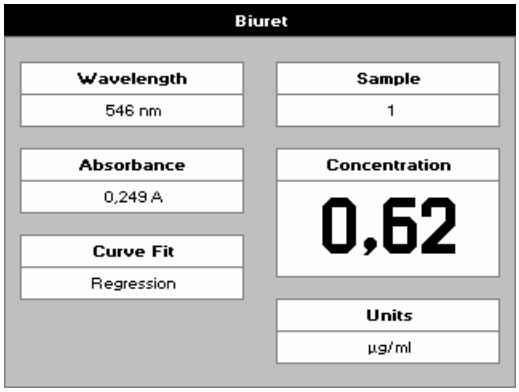

Results screen
Step 14
Insert the reference and press the 0A/100%T key. This will be used for all subsequent samples until changed.
Step 15
Insert the sample and press ◈.
The concentration of the sample is taken and displayed.
Repeat step 15 for all samples.
Press ▽ to return to the Protein Folder.

Press ☒☒☑ to display available Options which are described below.

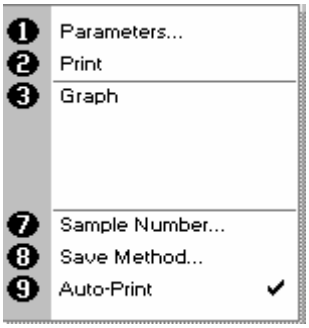

Options (select using key pad numbers)
1. Return to parameters screen (step 1 above).
2. Print result via selected method.
3. Toggle graph on/off. Displays the calibration graph, cursors give values for last measured sample.
7. Sample number – add a prefix to the sample number and reset the incrementing number to the desired value.
8. Save method – use the left and right arrows to select a folder to store in (Favorites/Methods 1-9), press the down arrow and enter name.
9. Auto-print – toggles auto-print on/off.

Exit options by pressing ▽, or wait.

Bacterial Cell Culture Measurement (OD600)

- Bacterial cell cultures are routinely grown until the absorbance at 600 nm (known as OD600) reaches approximately 0.4 prior to induction or harvesting. A linear relationship exists between cell number (density) and OD 600 up to approximately 0.6.
- It is important to note that for turbid samples such as cell cultures, the absorbance measured is due to light scattering, and **not** the result of molecular absorption. The amount of scatter is affected by the optics of the system (distance between the cell holder and instrument exit slit, geometry of this slit and the monochromator optics). Different spectrophotometer types therefore give different responses for the same turbid sample; to compare results, they must be normalised using calibration curves.
- A calibration curve can be determined by comparing measured OD 600 to expected OD 600. Expected OD 600 is determined by counting cell number using an alternative technique (for example microscope slide method) and converting to OD 600 using the rule of thumb that 1 OD 600 = 8 x 10^8 cells/ml for E. Coli.
- Your Vision spectrophotometer has much smaller optics than most conventional spectrophotometers, and more light is transmitted through to the detector resulting in lower than expected OD 600 values. Results obtained by comparing measured OD 600 with expected OD 600 (see above) indicate that a correction factor of 2.0 is required to make the data comparable to larger instruments; this factor is included as a default value in set up.
- The use of 10 mm pathlength disposable cells is recommended for optical density measurements of cell culture solutions; to prevent the suspension settling too quickly and giving an OD that changes with time, glycerol should be added to the sample.

The procedure is as follows:

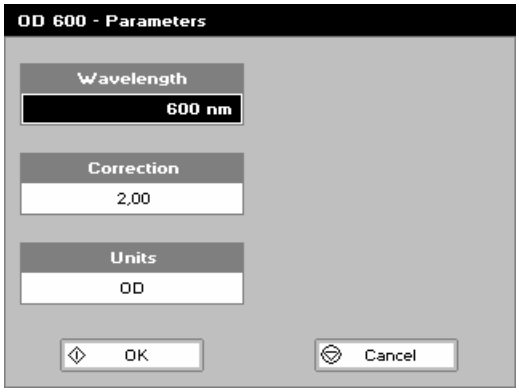

Step 1
Select the wavelength. Default value is 600 nm.
Press the down arrow.
Step 2
Enter the factor to compensate for different optical configurations between this and other instruments. Default value is 2.
Press the down arrow.
Step 3
Select the units. Options are OD or cells/ml. If cells/ml is selected two further parameters are displayed.

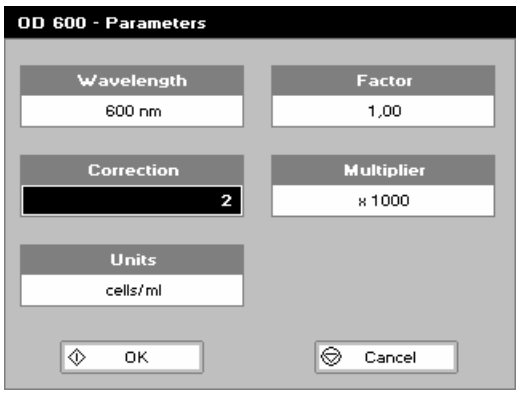

Step 4 (if cells/ml selected)
Enter the factor using the keypad numbers. Range 0.00 to 9999.
C button backspaces and clears the last digit entered.
Press the down arrow.
Step 5 (if cells/ml selected)
Select the multiplier using the left and right arrows. Options are 1000 or 1,000,000.
Step 6
Press OK to enter the Results screen
OR
Press Cancel to cancel selections and return to the Life Science folder.

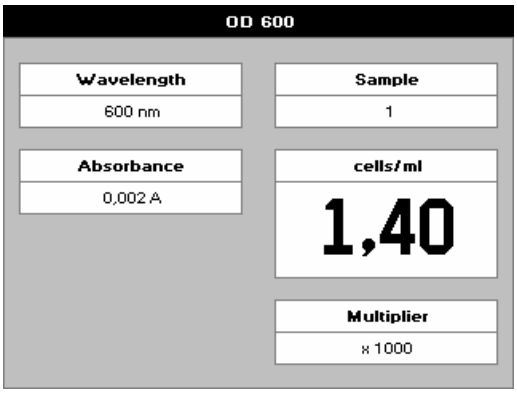

Results Screen
Step 8
Insert the reference and press the 0A/100%T key. This will be used for all subsequent samples until changed.
Step 9
Insert the sample and press ◈.
The wavelength, absorbance and OD600 value is displayed.

Repeat step 9 for all samples.
Press ⊽ to return to the Life Science Folder.

Press ☒☒☑ to display available Options which are described below.

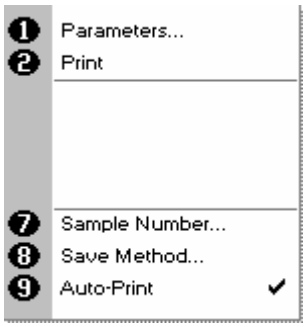

Options (select using key pad numbers)
1. Return to parameters screen (step 1 above).
2. Print result via selected method.
7. Sample number – add a prefix to the sample number and reset the incrementing number to the desired value.
8. Save method – use the left and right arrows to select a folder to store in (Favorites/Methods 1-9), press the down arrow and enter name.
9. Auto-print – toggles auto-print on/off.

Exit options by pressing ⊽, or wait.

FAVORITES AND METHODS FOLDERS

These folders are the storage locations for any user modified Applications (Methods) that are saved in the Options menu. Both are accessible from the home folders page.

Favorites:
This folder enables the user to quickly select any frequently used Methods. Up to 9 Methods may be stored in the folder.

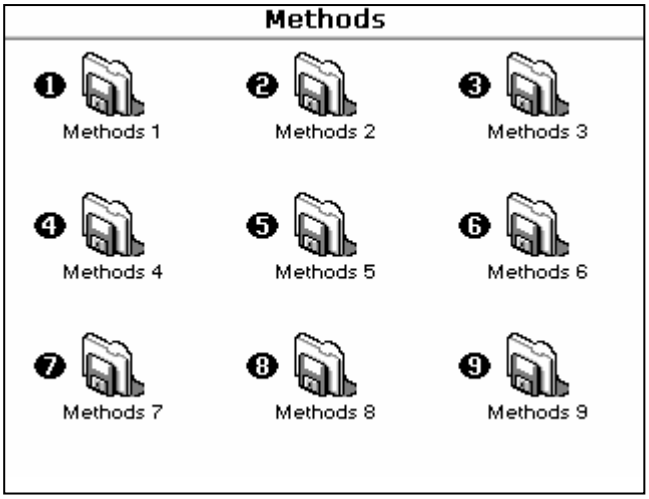

Methods:
These are further storage folders enclosed in the top level Methods folder. Up to 9 Methods may be stored in each folder.
Operation is identical to the Favorites Folder.
Saved methods can be locked, unlocked and deleted using the Options menu. Select the method by pressing the relevant key pad number and then press the ☒☒☑ key.

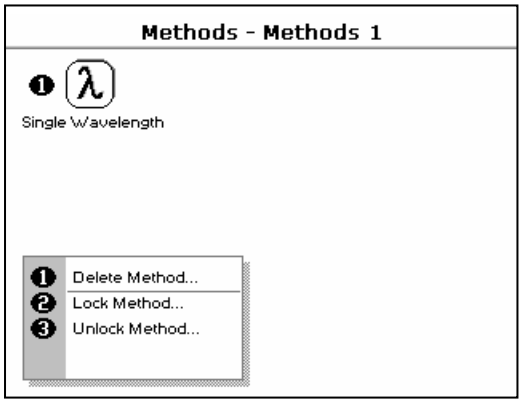

Delete Method
Press 1 to select delete method.
Select the method to be deleted using the left and right arrows.
Press ◈ to delete the method
OR ⊘ cancel to return to Favorites/Methods folder.

Lock Method
Press 2 to select lock method.
Select the method to be locked using the left and right arrows.
Press the down arrow.
Select a pass key using the keypad numbers or left and right arrows.
Press ◈ to lock the method
OR ⊘ cancel to return to the Favorites/Methods folder.

Unlock Method
Press 3 to select unlock method.
Select the method to be unlocked using the left and right arrows.
Press the down arrow.
Enter the pass key using the keypad numbers or left and right arrows.
Press ◈ to unlock the method
OR ⊘ cancel to return to the Favorites/Methods folder.

UTILITIES FOLDER

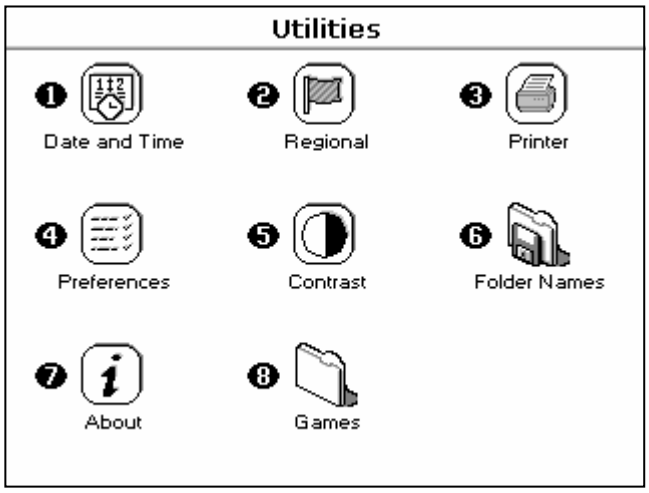

Summary

Function	Keypad number	Description
1 Date and Time	1	Set correct time and date
2 Regional	2	Select preferred language and number format
3 Printer	3	Printer/output options
4 Preferences	4	Select screen layout (themes) and history
5 Contrast	5	Adjust screen contrast & brightness
6 Folder Names	6	Re-name Method folders
7 About	7	Serial number and software version
8 Games	8	Spectro Blocks/Sudoku

Utilities

1: Date and Time

The procedure is as follows:

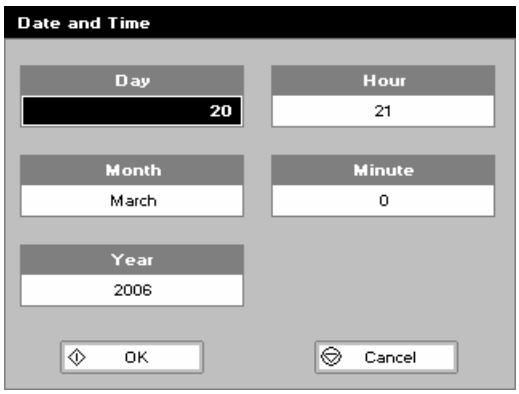

Enter the day using the keypad numbers or left and right arrows.
Press the down arrow.
Enter the month as above.
Press the down arrow.
Enter the year.
Press the down arrow.
Enter the hour.
Press the down arrow
Enter the minute. Seconds are zeroed when OK is pressed.
Press OK ◈ to store the settings and return to the Utilities folder
OR
Press Cancel ⊗ to return to the Utilities folder without storing the time.

2: Regional

Sets Language and Number Format
The procedure is as follows:

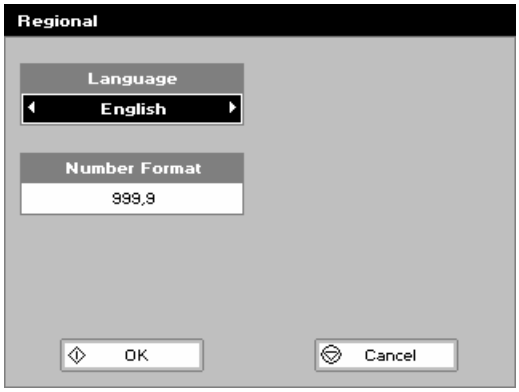

Select a language. Options are French, English, or Spanish. (German and Italian will be released in the near future).
Press the down arrow.
Set the decimal point style. Options are "," or ".".
Press OK ◈ to store the settings and return to the Utilities folder
OR
Press Cancel ⊗ to return to the Utilities folder without storing the settings.

3: Printer

Sets up printing options
The procedure is as follows:

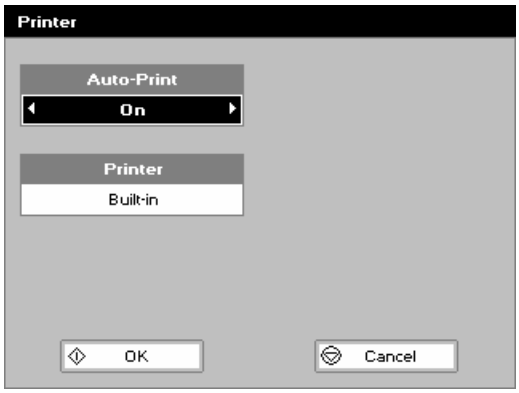

Select whether auto-print is on or off using the left and right arrows. When auto-print is on the results are automatically printed after a measurement is taken. When it is off printing has to be initiated manually. This can also be set using the Options key (☒☒☑) in each application or method. The default is OFF.
Press the down arrow.
Select how the data are sent. Options are Built in (internal printer), SD Card accessory or to a computer via USB port or Bluetooth.
Press OK ◈ to store the settings and return to the Utilities folder
OR
Press Cancel ⊗ to return to the Utilities folder without storing

4: Preferences

Sets user preferences
The procedure is as follows:

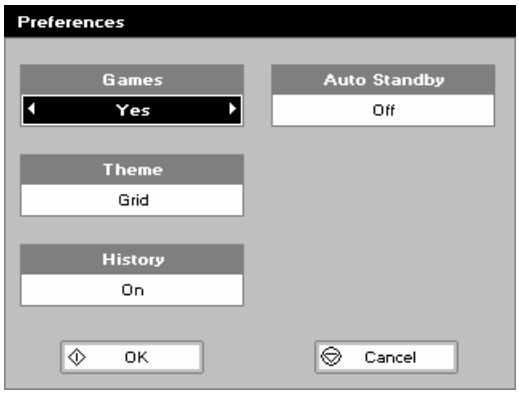

Select games function. This determines whether the games folder is displayed or not. Options are yes or no.
Press the down arrow.
Define the screen layout of folders. Options are either a grid format (default) or a list.
Press the down arrow.
Select whether to use previously entered parameters on switch on or use defaults.
Press the down arrow.
Select whether to use a standby mode after defined periods. Options are 1 hour, 2 hours, at night or off.
Press OK to store the settings and return to the Utilities folder
OR
Press Cancel to return to the Utilities folder without storing the settings.

5: Contrast

Ambient temperature can affect the display. This function can optimize the display for local conditions
The procedure is as follows:

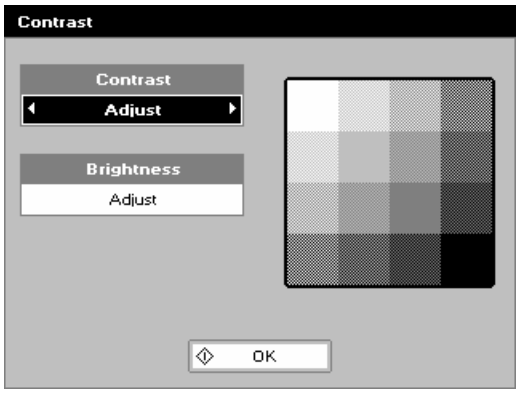

Adjust the contrast using the left and right arrows.
Press the down arrow.
Adjust the brightness using the left and right arrows.
Press the down arrow.
Press OK to store the settings and return to the Utilities folder

6: Folder Names

This folder allows you to rename the method or favourite folders

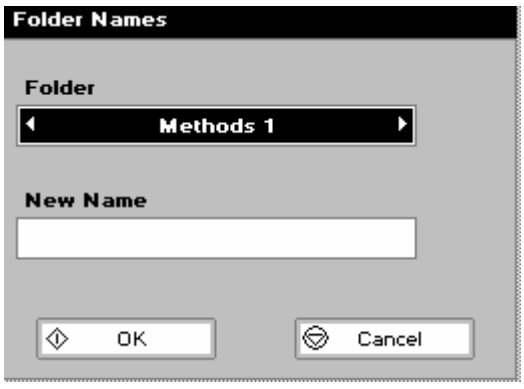

Select the folder you wish to rename using the left and right arrows.
Press the down arrow.
Input the new name for the folder.
Press OK to store the settings and return to the Utilities folder
OR
Press Cancel to return to the Utilities folder without storing the settings.

7: About

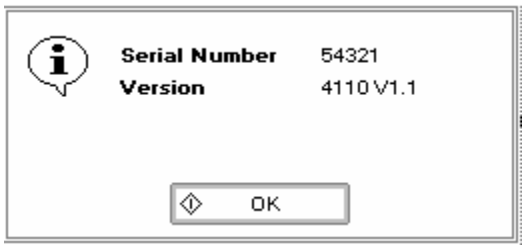

Displays the instrument serial number and software version.

Press OK ◈ to close the window and return to the Utilities folder

8: Games

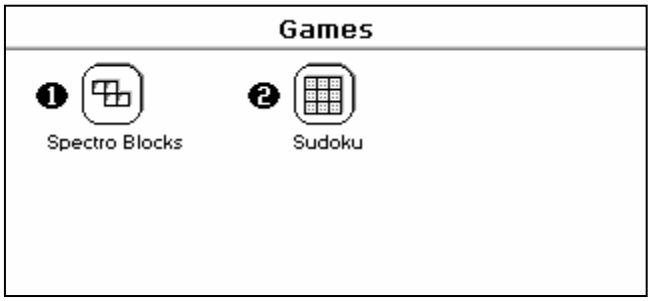

1: Spectroblocks

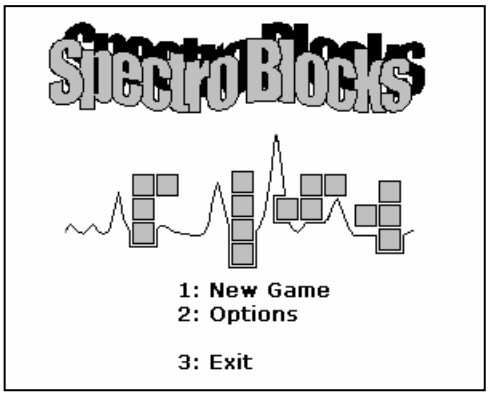

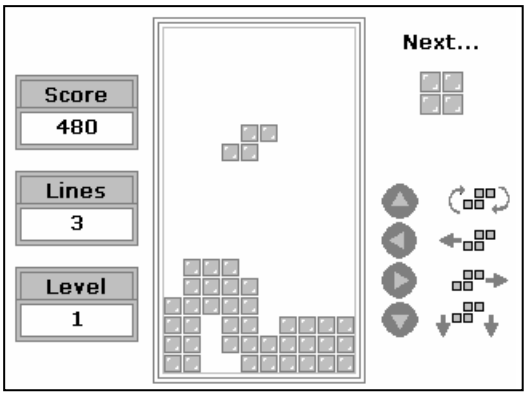

Classic block dropping game. Follow the instructions!
Press Cancel ▽ to return to the Utilities folder without storing the settings.

2: Sudoku

Can be set up as Computer mode (50 preset games) or User mode (enter your own pattern)

Use the cursors to select the square and the key pad to enter a number. Invalid numbers cannot be entered. Cells can be locked (or unlocked) by using the decimal point. Unlocked cells can be cleared using the C key (see also option key below)

The user mode starts with a blank grid.

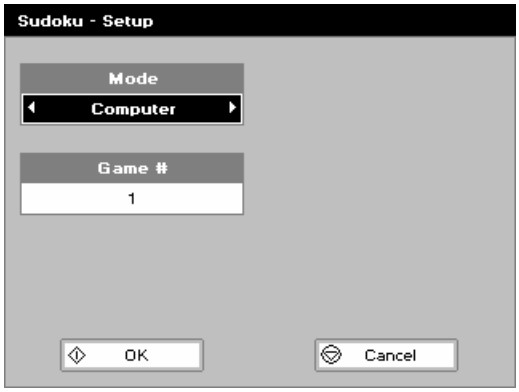

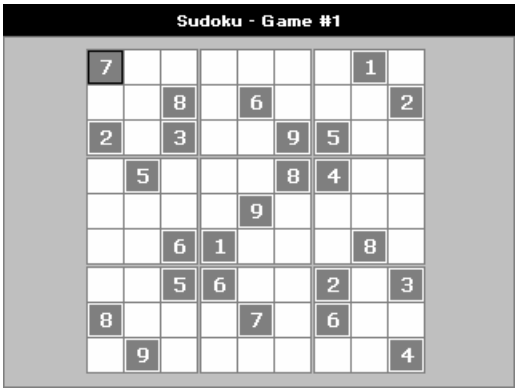

Options
Press ☒☒☑ to display the options menu

1. Return to the set-up screen.
3. The instrument solves the game for you!
4. Clear all entries.
8. Save the game. Use the left and right arrows to select a folder to store the game in (Favourites, Methods 1-9), press the down arrow and enter name.

Press Cancel ⊽ to return to the Utilities folder.

ACCESSORIES INSTALLATION

Printer installation

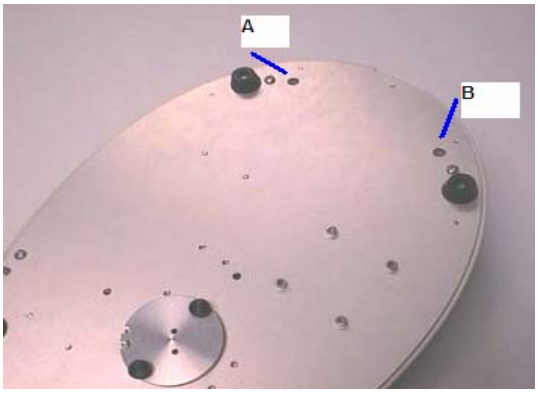

1. REMOVE THE POWER CABLE FROM THE INSTRUMENT. Turn the instrument over and remove cap head screws from positions A and B using the Allen wrench provided.

2. Turn the instrument back over and lift the accessory cover vertically upwards to remove. Remove the tie-wrap from the cable.

3. Plug the accessory cable into the printer, there is a lug to show the correct way round.

4. Lower the printer onto the locating pins and push down firmly. Turn the instrument over and replace the cap head screws as per step 1.

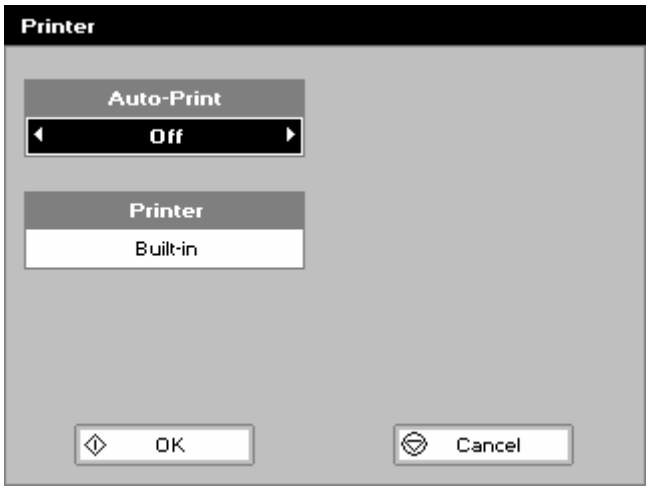

Switch the instrument on and go to utilities/instrument/preferences and select the Built-in printer.

Loading / changing the printer paper

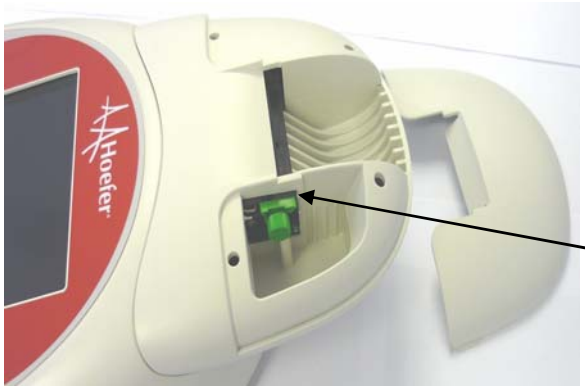

1. Lift off the paper cover.

Lock the platen and turn the knob to feed the paper

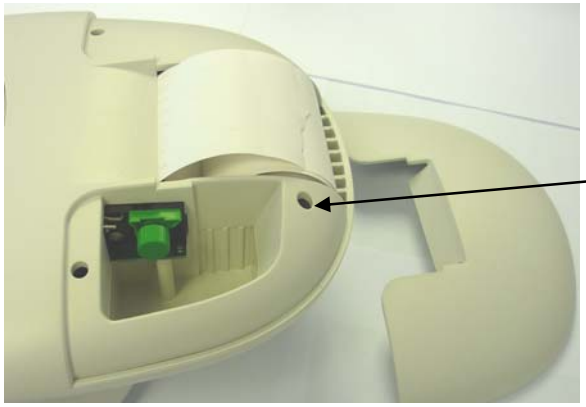

2. Feed in the paper.

Sometimes it helps if the platen lock is released.

3. Paper gripped.

4. Replace paper cover.

Bluetooth accessory installation

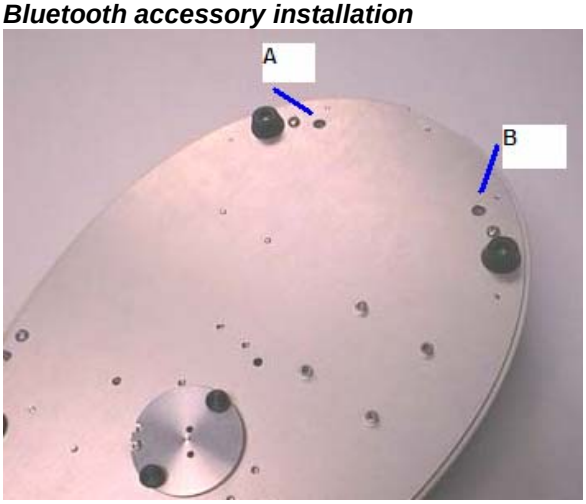

1. REMOVE THE POWER CABLE FROM THE INSTRUMENT. Turn the instrument over and remove the cap head screws from positions A and B using the Allen wrench provided.

2. Turn the instrument back over and lift the accessory cover vertically upwards to remove. Remove the tie-wrap from the cable.

3. Plug the accessory cable into the Bluetooth module.

5. Note the slots in the base of the case. The two lugs on the Bluetooth module plug into these.

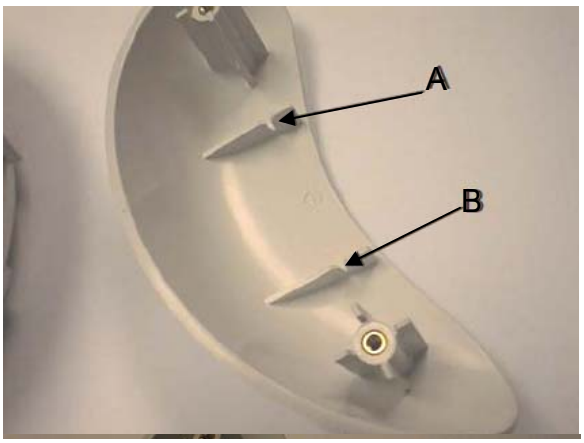

5. Note the slots in the accessory cover, designed to engage with the Bluetooth accessory PCB.

6. Lower the accessory cover vertically downwards onto the instrument, engaging the PCB in the slots.

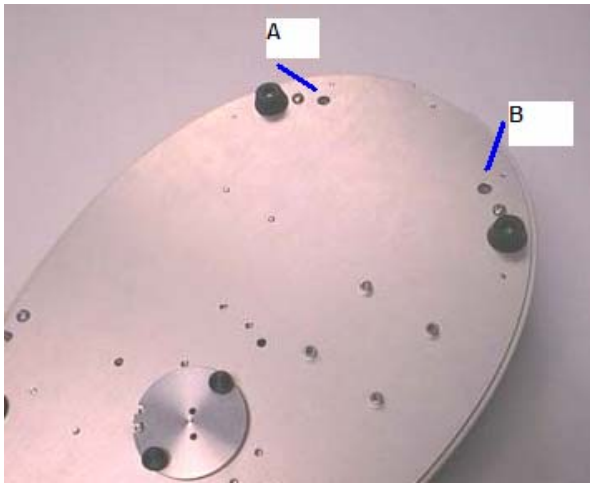

7. Invert the instrument and replace the cap head screws at A and B.

8. Attach the license label as shown.

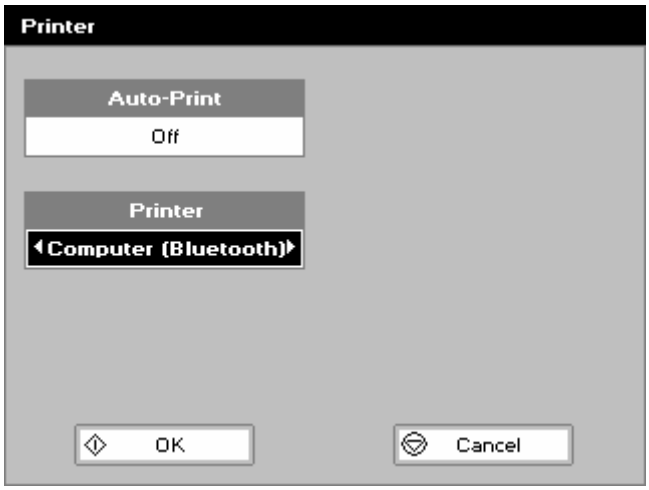

9. Switch the instrument on and go to the preferences page under utilities/instrument, and select the Bluetooth option.

PRINT VIA COMPUTER

- PVC (Print Via Computer) is a small application running under Windows 2000™ or Windows XP™ to enable a Vision spectrophotometer to transfer data into a PC environment. From there the user has a selection of choices, the data can be both printed or saved (in a variety of formats). PVC is capable of supporting several instruments simultaneously, limited only by hardware and the speed of the host system.
- PVC can operate via USB and Bluetooth simultaneously
- PVC can store data either to a common directory or be configured to save to independent directories by both file format and connection.
- PVC can save data in graphics format, text format or as an Excel™ file

Installation

See the manual included on the PVC CDROM for installation and operating instructions.

ACCESSORIES

USB cable(spare)	source locally
Built-in printer accessory	80-3003-84
Bluetooth accessory	80-3003-96
SD Card accessory	80-3005-00

MAINTENANCE

When using calibration standard filters, insert such that the flat surface is facing away from the spring end of the cell holder.

Observe all necessary precautions if dealing with hazardous samples or solvents.

Lamp Replacement

The Xenon lamp should not need replacement until after several years of use. In the unlikely event that it does need replacing, this should be undertaken by a service engineer from your supplier.

Cleaning and general care of the instrument

External cleaning
Switch off the instrument and disconnect the power cord.
Use a soft damp cloth.
Clean all external surfaces.
A mild liquid detergent may be used to remove stubborn marks.

Changing cell holder or removal for cleaning
This can be removed by undoing the appropriate screws on the bottom of the instrument.

SPECIFICATION AND WARRANTY

Wavelength range	190 - 1100 nm
Monochromator	Flat grating
Wavelength calibration	Automatic upon switch on
Spectral bandwidth	5 nm
Wavelength accuracy	±2 nm
Wavelength reproducibility	±1 nm
Light sources	Pulsed xenon lamp
Detector	1024 element CCD array
Photometric range	- 0.300 to 2.500A, 0 to 199%T
Photometric linearity	±0.005 Abs or 1% of the reading, whichever is the greater @ 546 nm
Photometric reproducibility	±0.003 Abs (0 to 0.5 Abs), ±0.007 Abs (0.5-1.0 Abs)
Stray light	<0.5% at 220 nm and 340 nm using $NaNO_2$
Zero stability	±0.01 Abs/hour after 20 min warm up @ 340 nm
Noise	0.005 pk to pk 0.002 pms
Digital output	USB port standard, Bluetooth option
Dimensions	260 x 390 x 100 mm
Weight	<4.5 kg
Power input	90-250 V, 50/60 Hz, Max 30 VA

Specifications are measured after the instrument has warmed up at a constant ambient temperature and are typical of a production unit. As part of our policy of continuous development, we reserve the right to alter specifications without notice.

Warranty

- Your supplier guarantees that the product supplied has been thoroughly tested to ensure that it meets its published specification. The warranty included in the conditions of supply is valid for 12 months only if the product has been used according to the instructions supplied. The supplier can accept no liability for loss or damage, however caused, arising from the faulty or incorrect use of this product.
- This product has been designed and manufactured by Hoefer, Inc., 84 October Hill Road, Holliston, MA 01746. However, please contact your dealer if you experience technical or sample handling difficulties.